

General Information

Date & Time: 28, Apr, 2025 16:35

Make	Toyota	Model	Wigo
YOM	2021	Mileage	46,915
Registration No.	DAU9064	Chassis No.	MHKA4DF5FMJ052924
CC	1.0	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	Gray		

Body / Panel Condition



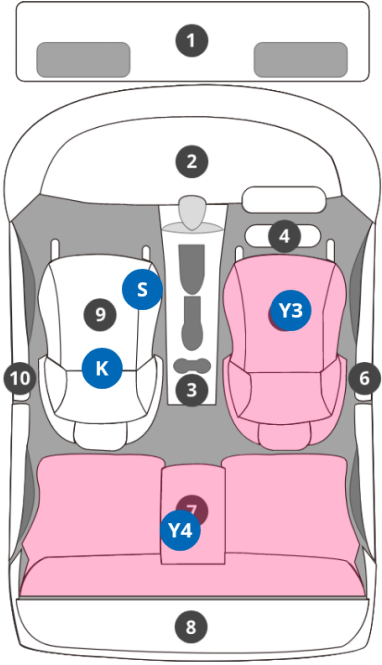
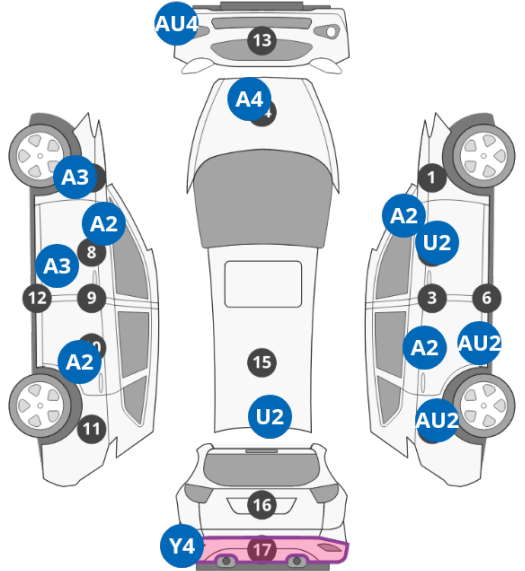
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	77.0	78	87	66
2	Boot Lid	87.1	85	88	88
3	Roof	80.4	75	80	86/81
4	Left Front Fender	80.1	77	86	78
5	Left Front Door	78.5	76	80	79
6	Center Panel Left				
7	Left Rear Door	347.0	771	119	151
8	Left Back Panel	316.6	100	295	555
9	Right Front Fender	82.0	88	85	73
10	Right Front Door	82.5	84	83	80
11	Center Panel Right				
12	Right Rear Door	83.0	81	85	83
13	Right Back Panel	83.8	89	85	77

Overall Evaluation :

D

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Smell - Yes / Overall Interior - Animal Hair - Yes / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Large	Remarks Bonnet - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Crack, Gap - Large / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Medium / (L) Front Fender, Molding - Scratch - Medium / Bonnet, Headlight - Scratch - Large / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Front Door, Molding - Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch - Small / (R) Mirror - Scratch - Small / (L) Mirror - Scratch - Small / Roof - Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Small
Frame Evaluation : B	Functional Evaluation : A
Remarks Under Spare Box - Bulge (Cuts, Major Deforms) or Corrosion ? - Yes	Remarks Spare Key - Issue - Unexist

Inspector Notes
with LTO plate and warranty booklet/ with jack and spare tire/ with tools/ abnormal noise on right front window