

General Information

Date & Time: 28, Apr, 2025 17:49

Make	Toyota	Model	Avanza
YOM	2023	Mileage	41,039
Registration No.	NIO1767	Chassis No.	MHFAB1BYXP3062770
CC	1.5	Transmission	CVT
Fuel Type	Gas	Type of Body	MPV
Colour	Green		

Body / Panel Condition



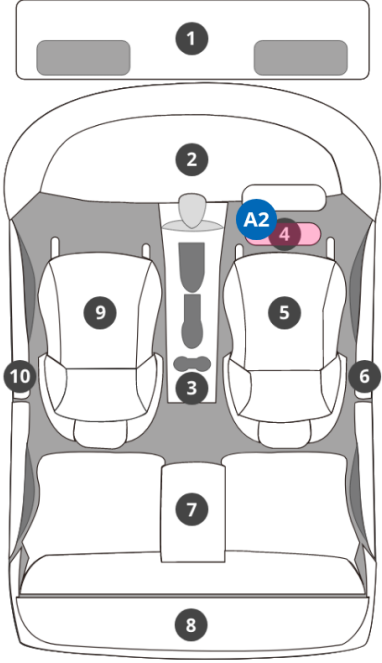
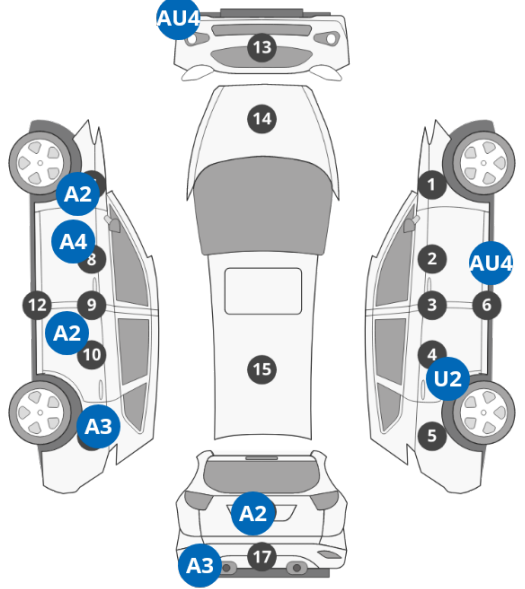
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	90.6	94	81	98
2	Boot Lid	97.6	99	109	85
3	Roof	90.8	100	95	78/90
4	Left Front Fender	83.6	77	82	92
5	Left Front Door	88.0	89	82	93
6	Center Panel Left				
7	Left Rear Door	90.9	95	85	93
8	Left Back Panel	94.3	102	94	87
9	Right Front Fender	87.4	92	88	82
10	Right Front Door	85.7	86	84	87
11	Center Panel Right				
12	Right Rear Door	93.3	92	90	98
13	Right Back Panel	95.0	93	88	104

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : A	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Cut, Crack - Small	Remarks (R) Rear Door, Molding - Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (L) Front Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Large / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
no warranty booklet/ no tools/ with spare tire and jack / with LTO plate/ plate light issue