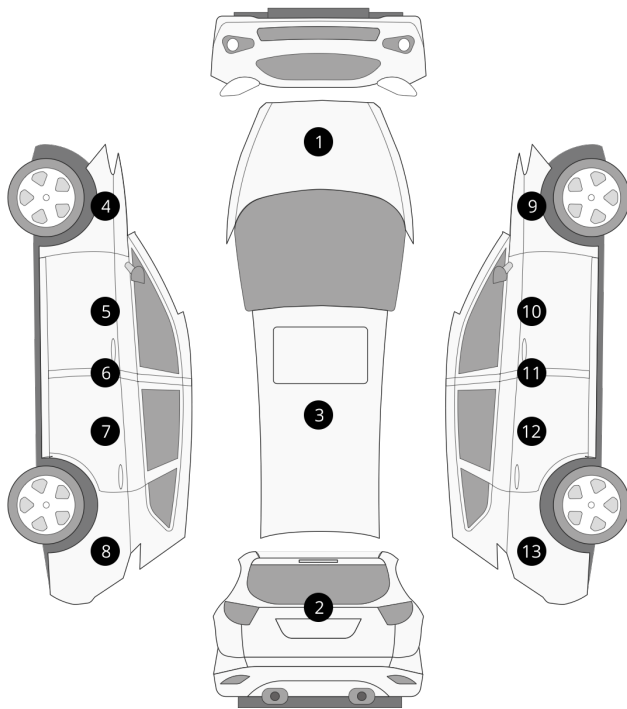


## General Information

Date & Time: 29, Apr, 2025 08:25

|                  |         |              |                   |
|------------------|---------|--------------|-------------------|
| Make             | Toyota  | Model        | Rush              |
| YOM              | 2020    | Mileage      | 51,250            |
| Registration No. | NFU7080 | Chassis No.  | MHKE8FF3PKK019151 |
| CC               | 1.5     | Transmission | A/T               |
| Fuel Type        | Gas     | Type of Body | Wagon             |
| Colour           | White   |              |                   |

## Body / Panel Condition



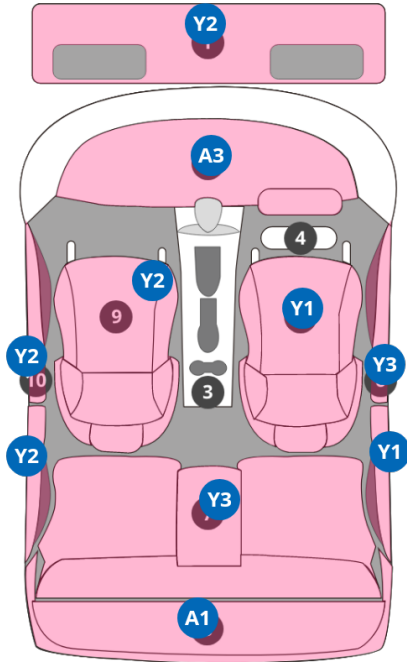
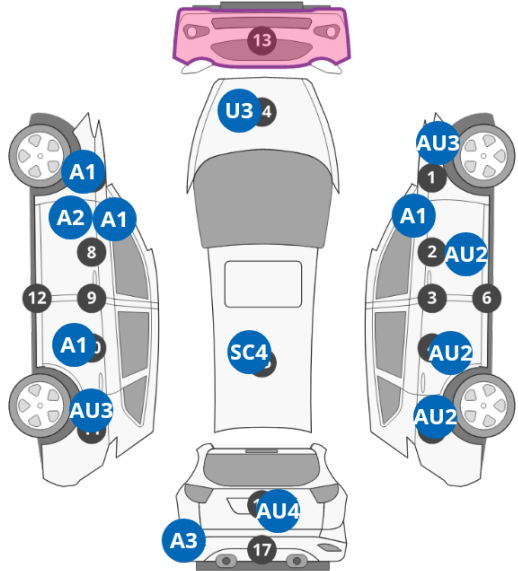
| #  | Area               | Thickness(um) |        |        |          |
|----|--------------------|---------------|--------|--------|----------|
|    |                    | Average       | Value1 | Value2 | Value3/4 |
| 1  | Bonnet             | 82.2          | 88     | 77     | 82       |
| 2  | Boot Lid           | 84.1          | 88     | 81     | 84       |
| 3  | Roof               | 72.8          | 60     | 65     | 83/84    |
| 4  | Left Front Fender  | 90.1          | 100    | 91     | 80       |
| 5  | Left Front Door    | 85.0          | 84     | 87     | 84       |
| 6  | Center Panel Left  |               |        |        |          |
| 7  | Left Rear Door     | 86.6          | 85     | 89     | 87       |
| 8  | Left Back Panel    | 84.5          | 88     | 85     | 81       |
| 9  | Right Front Fender | 88.6          | 78     | 91     | 96       |
| 10 | Right Front Door   | 89.0          | 82     | 97     | 89       |
| 11 | Center Panel Right |               |        |        |          |
| 12 | Right Rear Door    | 85.2          | 81     | 88     | 87       |
| 13 | Right Back Panel   | 82.1          | 89     | 81     | 77       |

## Overall Evaluation :

C

### Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

| Interior Evaluation : <span style="color: red;">C</span>                                                                                                                                                                                                                                                                                                                         | Exterior Evaluation : <span style="color: red;">E</span>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                               |
|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
|  <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>                                                                                                                               |  <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>                                                                                                                                                                                                                                                                                                                                                                                                |
| <b>Remarks</b><br>Trunk Room - Worn, Scratch, Cut, Crack - Minimal / (R) Front Trim - Grime - Medium / (R) Front Seat - Grime - Minimal / Rear Seat - Grime - Medium / (R) Rear Trim - Grime - Minimal / (L) Rear Trim - Grime - Small / (L) Front Trim - Grime - Small / Ceiling - Grime - Small / (L) Front Seat - Grime - Small / Steering Wheel - Worn, Peel, Crack - Medium | <b>Remarks</b><br>(R) Front Fender, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch & Dent - Small / (R) Mirror - Scratch - Minimal / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Repair mark - Difference in Color / Bonnet, Headlight - Dent - Medium / Roof - Rust, Corrosion - Large |
| Frame Evaluation : <span style="color: red;">A</span>                                                                                                                                                                                                                                                                                                                            | Functional Evaluation : <span style="color: red;">A</span>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                             |
| <b>Remarks</b><br>Defects not found                                                                                                                                                                                                                                                                                                                                              | <b>Remarks</b><br>Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                 |

| Inspector Notes                                                                                                                                                                        |
|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| with LTO plate, no warranty booklet, with jack, no tools, with spare tire, cracked left side mirror, right fog lamp cover missing, front bumper difference in color, plate light issue |