

General Information

Date & Time: 29, Apr, 2025 08:48

Make	Toyota	Model	Vios
YOM	2023	Mileage	74,943
Registration No.	NHI7499	Chassis No.	PA1B18F35P4207822
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



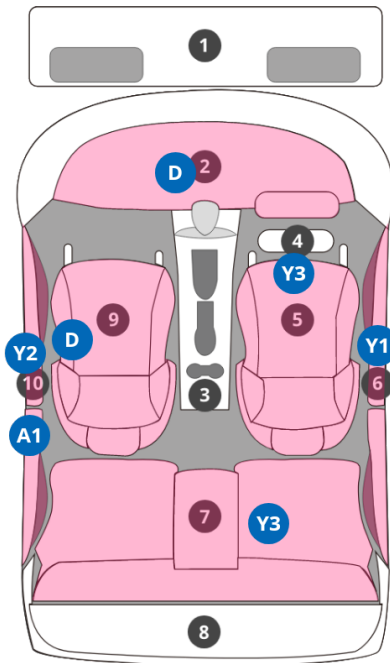
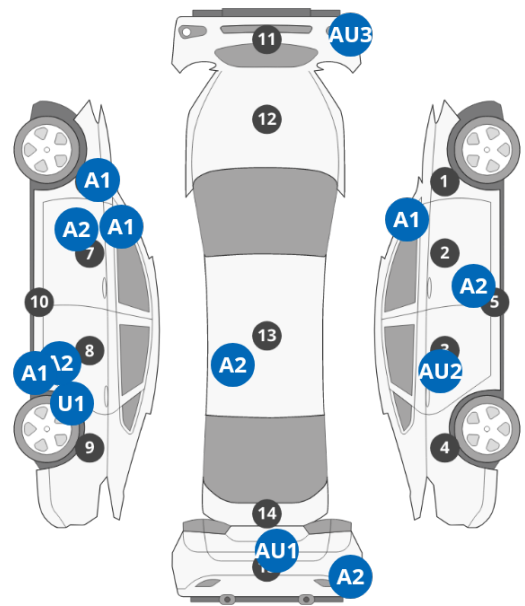
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	91.7	94	88	94
2	Boot Lid	96.3	94	83	112
3	Roof	83.5	77	84	80/93
4	Left Front Fender	76.0	72	74	82
5	Left Front Door	84.0	86	82	84
6	Center Panel Left				
7	Left Rear Door	78.0	85	75	75
8	Left Back Panel	88.2	95	83	87
9	Right Front Fender	86.2	87	82	90
10	Right Front Door	87.5	86	87	90
11	Center Panel Right				
12	Right Rear Door	89.6	86	89	95
13	Right Back Panel	88.0	84	90	90

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Medium / (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Minimal / (L) Rear Trim - Cut, Crack - Minimal / (L) Front Trim - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / (L) Front Seat - Worn - Yes	Remarks (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / (L) Rear Fender, Molding - Dent - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Roof - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes

no warranty booklet, no jack, incomplete tools, with spare tire, with LTO plate