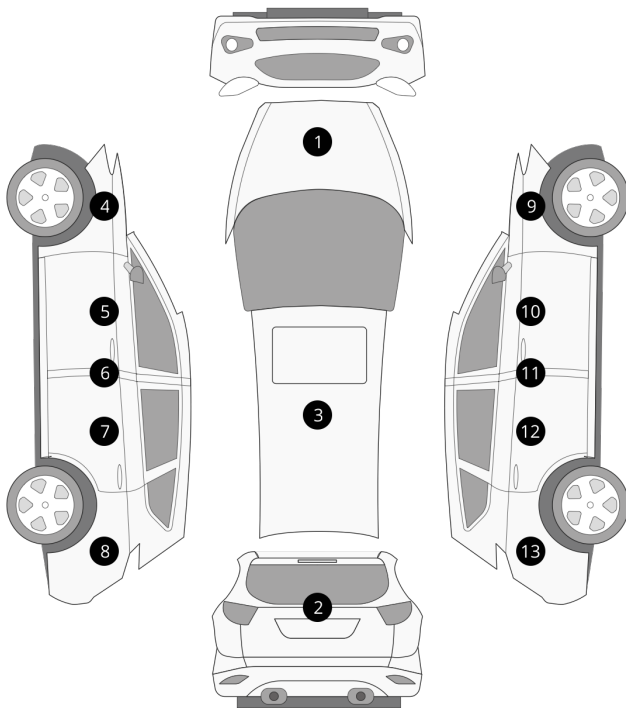


General Information

Date & Time: 28, Apr, 2025 18:27

Make	Toyota	Model	Vios
YOM	2022	Mileage	31,354
Registration No.	DAQ6533	Chassis No.	PA1B18F32N4178048
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



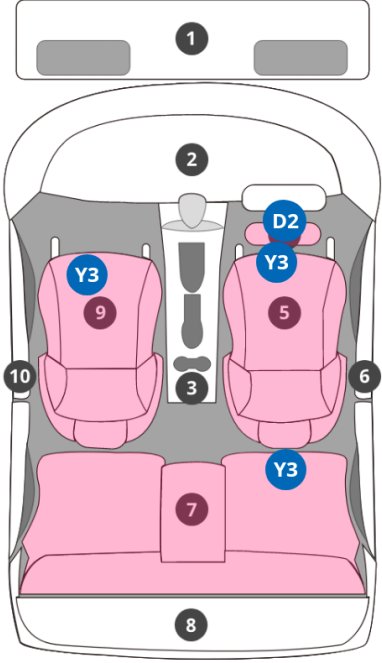
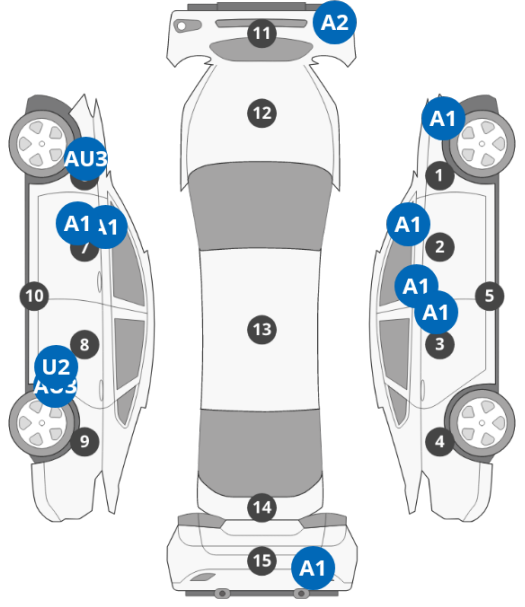
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	95.8	95	93	100
2	Boot Lid	93.6	91	95	94
3	Roof	87.0	90	90	81/88
4	Left Front Fender	83.7	87	87	78
5	Left Front Door	93.8	89	96	97
6	Center Panel Left				
7	Left Rear Door	85.0	94	84	78
8	Left Back Panel	95.8	100	91	97
9	Right Front Fender	82.1	81	83	83
10	Right Front Door	89.0	82	95	90
11	Center Panel Right				
12	Right Rear Door	91.6	82	99	94
13	Right Back Panel	90.5	87	86	98

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / (R) Front Floor Mat - Grime - Medium / (L) Front Floor Mat - Worked - Small	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Dent - Small / (L) Front Fender, Molding - Scratch & Dent - Medium / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes

Inspector Notes
no warranty booklet, with jack and tools, with spare tire, with LTO plate