

## General Information

Date & Time: 25, Apr, 2025 15:37

<b>Make</b>	Nissan	<b>Model</b>	Terra
<b>YOM</b>	2020	<b>Mileage</b>	56,406
<b>Registration No.</b>	LAI6204	<b>Chassis No.</b>	MNTJCAD23Z0016380
<b>CC</b>	2.5	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Diesel	<b>Type of Body</b>	SUV
<b>Colour</b>	White		

## Body / Panel Condition



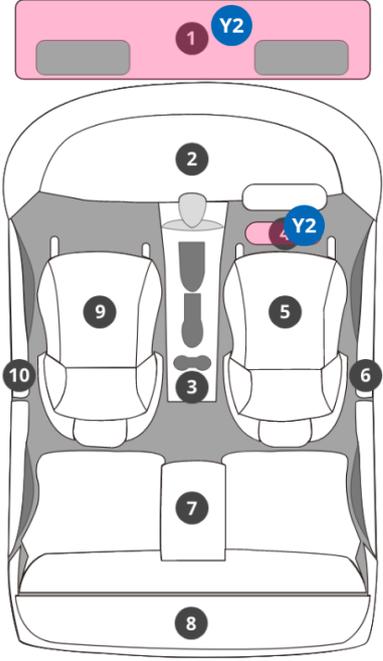
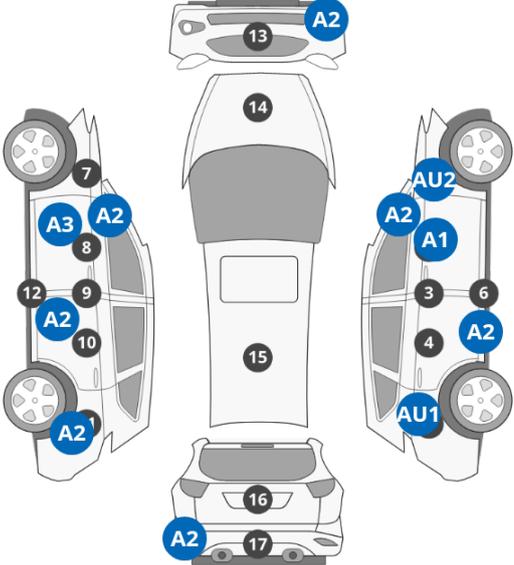
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	188.0	178	175	211
2	Boot Lid	108.6	112	100	114
3	Roof	94.1	92	92	96/97
4	Left Front Fender	113.6	116	118	107
5	Left Front Door	98.0	96	101	98
6	Center Panel Left				
7	Left Rear Door	102.7	102	108	98
8	Left Back Panel	115.0	118	113	114
9	Right Front Fender	118.0	118	123	113
10	Right Front Door	101.6	98	102	105
11	Center Panel Right				
12	Right Rear Door	97.8	93	100	101
13	Right Back Panel	108.3	111	110	104

Overall Evaluation :

**B**

### Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (R) Front Floor Mat - Grime - Small / Ceiling - Grime - Small</p>	<p><b>Remarks</b> Bonnet - Repair Traces - Yes / (L) Mirror - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Small / (R) Front Fender, Molding - Scratch &amp; Dent - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Mirror - Scratch - Small / (R) Rear Fender, Molding - Scratch &amp; Dent - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Battery - Weak - Yes / Wiper - Function - Weak / Horn - Issue - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>Without warranty booklet and tools. With Spare tire, jack and seat cover. 1 key. With LTO plate.</p>