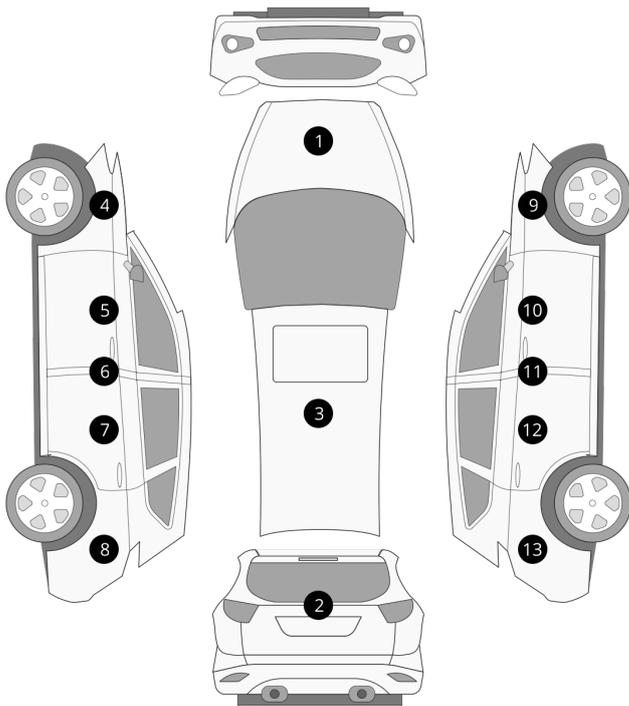


General Information

Date & Time: 28, Apr, 2025 12:34

Make	Suzuki	Model	Dzire
YOM	2022	Mileage	45,045
Registration No.	FAI7944	Chassis No.	MBHZF63B4NG156413
CC	1.2	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Brown		

Body / Panel Condition



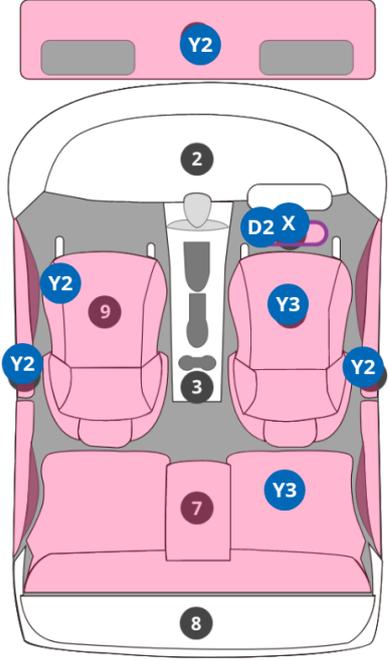
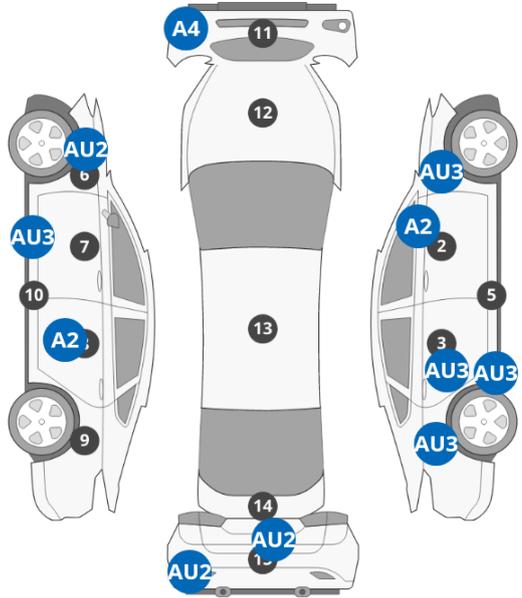
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	100.1	99	97	105
2	Boot Lid	82.0	88	80	79
3	Roof	105.8	101	99	110/113
4	Left Front Fender	106.3	109	106	104
5	Left Front Door	106.3	109	106	104
6	Center Panel Left				
7	Left Rear Door	99.8	105	101	94
8	Left Back Panel	103.6	102	106	103
9	Right Front Fender	100.3	100	101	100
10	Right Front Door	106.0	106	108	104
11	Center Panel Right				
12	Right Rear Door	96.5	89	97	104
13	Right Back Panel	100.8	92	109	102

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Mat Other - Missing - Yes / Ceiling - Grime - Small / (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / (L) Front Trim - Grime - Small / (L) Front Seat - Grime - Small / (L) Front Floor Mat - Worked - Small</p>	<p>Remarks (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (L) Front Fender, Molding - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Scratch - Large / (R) Mirror - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>without warranty booklet and seat cover. With spare tire, jack and tools. 1 key. With LTO plate.</p>