

General Information

Date & Time: 28, Apr, 2025 15:27

Make	Hyundai	Model	Reina
YOM	2019	Mileage	51,447
Registration No.	NFW2335	Chassis No.	LBECBADB5LW083223
CC	1.4	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Brown		

Body / Panel Condition



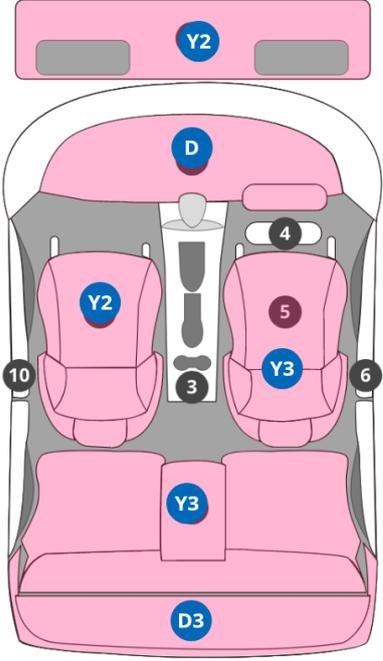
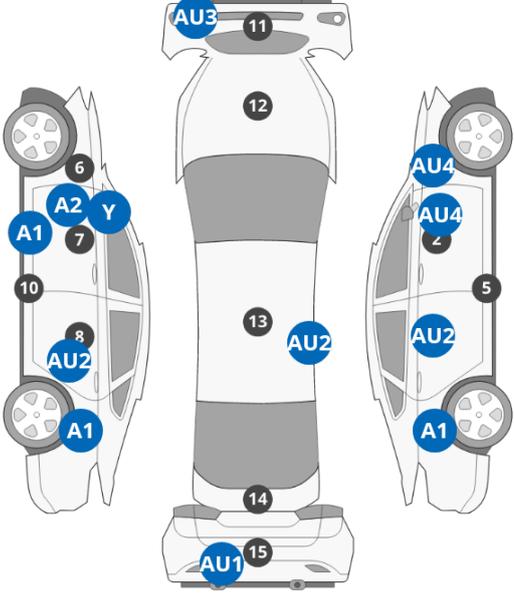
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	126.0	113	132	133
2	Boot Lid	103.0	109	95	105
3	Roof	93.2	95	102	91/84
4	Left Front Fender	105.0	108	108	99
5	Left Front Door	109.6	116	105	108
6	Center Panel Left				
7	Left Rear Door	115.3	117	113	116
8	Left Back Panel	121.0	117	131	115
9	Right Front Fender	128.9	99	125	163
10	Right Front Door	113.0	112	106	121
11	Center Panel Right				
12	Right Rear Door	117.3	113	117	122
13	Right Back Panel	119.3	134	116	108

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : A	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks Defects not found	Remarks (L) Rear Door, Molding - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / Roof - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / (L) Mirror - Crack - Damaged
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Retractable Mirror - Issue - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with spare tire and sest cover. Without warranty. booklet, tools, and jack. 1 key. With LTO plate.