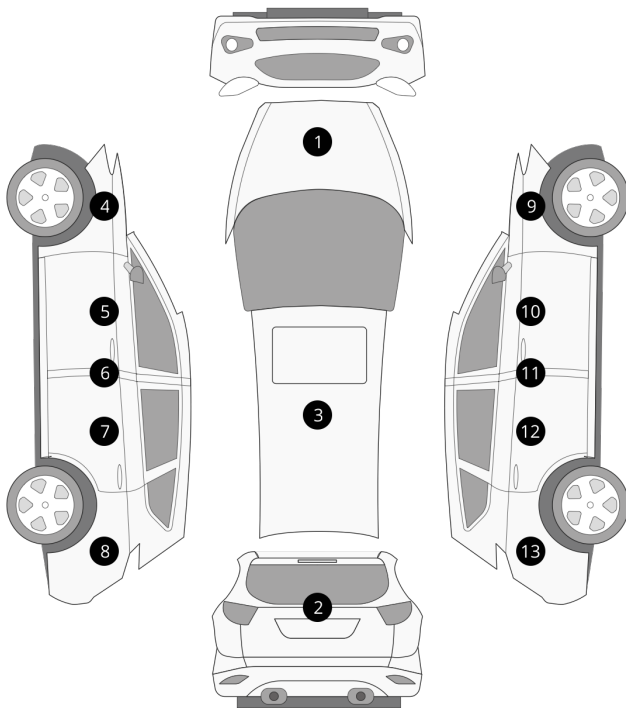


General Information

Date & Time: 28, Apr, 2025 18:58

Make	Toyota	Model	Corolla Altis
YOM	2006	Mileage	369,516
Registration No.	ZCK228	Chassis No.	ZZE1218017197
CC	1.6	Transmission	M/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



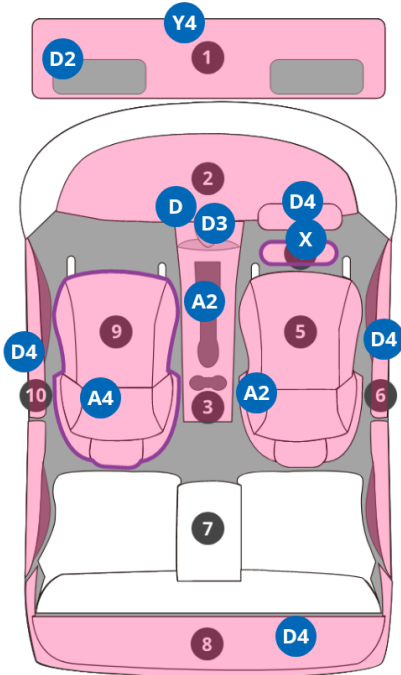
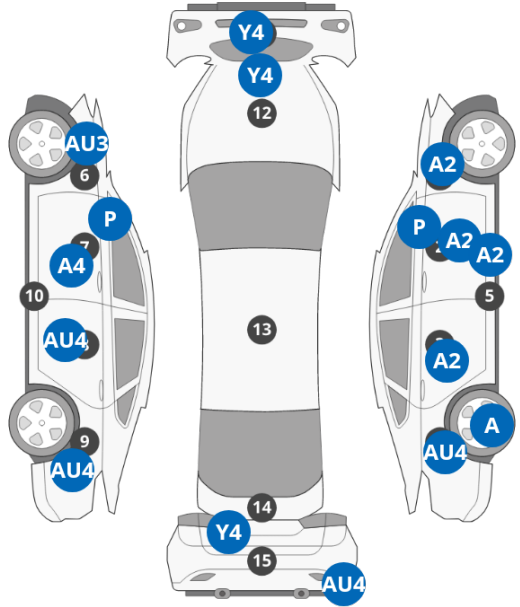
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	81.3	79	88	77
2	Boot Lid	127.0	123	136	122
3	Roof	71.6	87	74	60/65
4	Left Front Fender	144.0	144	144	144
5	Left Front Door	162.3	109	158	220
6	Center Panel Left				
7	Left Rear Door	267.6	283	267	253
8	Left Back Panel	172.0	173	172	171
9	Right Front Fender	107.0	105	96	120
10	Right Front Door	115.0	119	113	113
11	Center Panel Right				
12	Right Rear Door	110.6	108	108	116
13	Right Back Panel	106.6	108	104	108

Overall Evaluation :

E

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : E	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Worn as per age - Yes / Mat Other - Missing - Yes / Dashboard - Loose, Deformed - Large / (R) Front Seat - Cut, Crack - Small / (L) Front Seat - Cut, Crack - Large / (L) Front Seat Knobs - Partially Missing - Yes / Console, Switchs, Vents - Loose, Deformed - Medium / Dashboard - Traces of Adhesive Tape - Yes / Trunk Room - Loose, Deformed - Large / Knobs - Worn, Peel, Crack - Small / (L) Front Trim - Worked - Large / (R) Front Trim - Worked - Large / Sunvisor, Sunglass Holder - Loose, Deformed - Small / Ceiling - Grime - Large	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Rear Fender, Molding - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Overall Exterior - Faded(Color, Gloss) - Yes / (R) Rear Tyre - Crack, Cut - Yes / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Faded(Color, Gloss) - Yes / Front Bumper, Grille, Lamps - Crack, Gap - Large / Bonnet, Headlight - Crack, Gap - Large / (L) Front Fender, Molding - Scratch & Dent - Medium / (L) Mirror - Faded(Color, Gloss) - Yes / (L) Front Door, Molding - Scratch - Large / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch & Dent - Large / Trunk Hood, Rear Gate - Crack, Gap - Large
Frame Evaluation : B	Functional Evaluation : E
Remarks Under Spare Box - Bulge (Cuts, Major Deforms) or Corrosion ? - Yes / Under Spare Box - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Panel, Meter - Issue - Yes / Power Window (each) - Stuck, Gap - Yes / Shift Shock - Function - Weak / Air Conditioner - Function - Weak / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Turn Signal, Hazard Flasher - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Spare Key - Issue - Unexist

Inspector Notes
no warranty booklet/ no tools / with jack and spare tire/ power window issue/ plate light issue/ front. fender turn signals not working/ wiper issue / aircon issue/ panel meter issue/ flat tire/