

General Information

Date & Time: 04, Oct, 2024 16:04

Make	Toyota	Model	Vios
YOM	2024	Mileage	9,884
Registration No.	NFF3728	Chassis No.	PA1B18F32P4229387
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



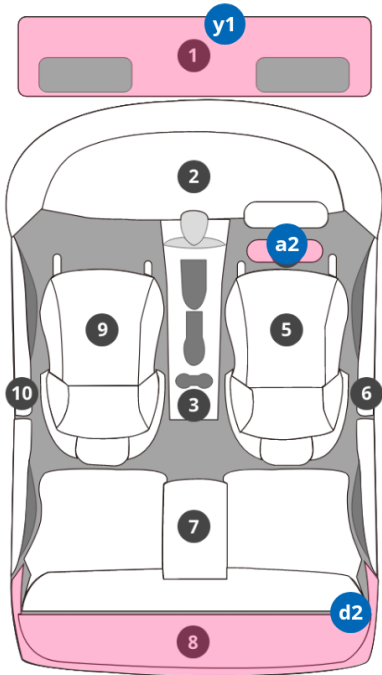
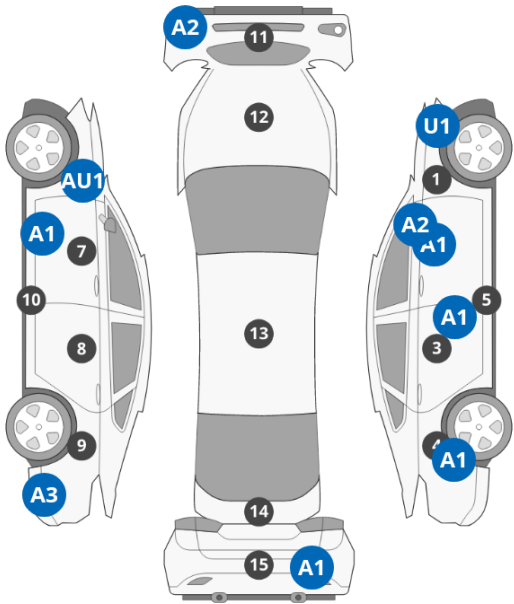
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	108.6	104	111	111
2	Boot Lid	104.3	103	100	110
3	Roof	102.6	111	97	100/102
4	Left Front Fender	102.6	104	104	100
5	Left Front Door	106.0	108	106	104
6	Center Panel Left				
7	Left Rear Door	106.3	108	101	110
8	Left Back Panel	117.0	123	122	106
9	Right Front Fender	106.6	103	109	108
10	Right Front Door	104.0	104	105	103
11	Center Panel Right				
12	Right Rear Door	101.2	99	98	107
13	Right Back Panel	113.6	105	107	129

Overall Evaluation :

A

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : A		Exterior Evaluation : B	
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain		 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap	
Remarks (L) Front Floor Lag - Cut, Crack - Small / Trunk Room - Loose, Deformed, Grime - Small / Ceiling - Grime - Minimal		Remarks (R) Step - Repair Traces - Yes / (R) Front Fender, Molding - Dent - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / (L) Front Fender, Molding - Scratch & Dent - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Mirror - Scratch - Small	
Frame Evaluation : A		Functional Evaluation : A	
Remarks Defects not found		Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist	

Inspector Notes

more light scratches around the exterior.