

General Information

Date & Time: 30, May, 2025 13:05

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	11,105
Registration No.	NKB8799	Chassis No.	PA1B18F33R4250462
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



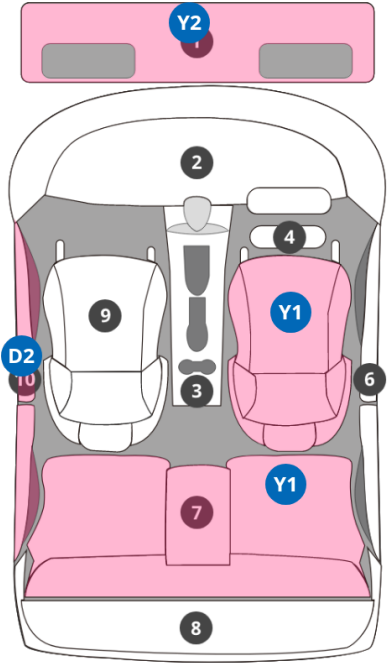
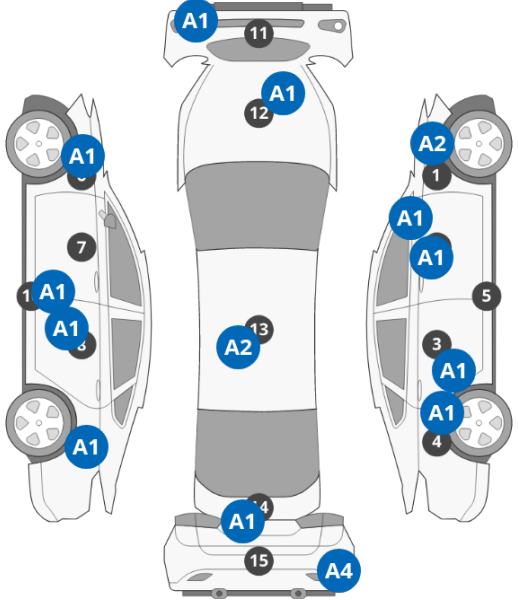
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	118.6	123	112	121
2	Boot Lid	110.6	109	111	112
3	Roof	103.0	108	100	103/101
4	Left Front Fender	104.6	108	101	105
5	Left Front Door	104.3	101	98	114
6	Center Panel Left				
7	Left Rear Door	112.6	121	110	107
8	Left Back Panel	110.0	119	107	104
9	Right Front Fender	118.5	100	100	156
10	Right Front Door	108.6	114	105	107
11	Center Panel Right				
12	Right Rear Door	110.3	102	112	117
13	Right Back Panel	109.6	112	110	107

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Minimal / (L) Front Trim - Worked - Small / (R) Front Seat - Grime - Minimal / Ceiling - Grime - Small</p>	<p>Remarks (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Scratch - Minimal / Roof - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate, with warranty booklet, with jack and incomplete tools, with spare tire</p>