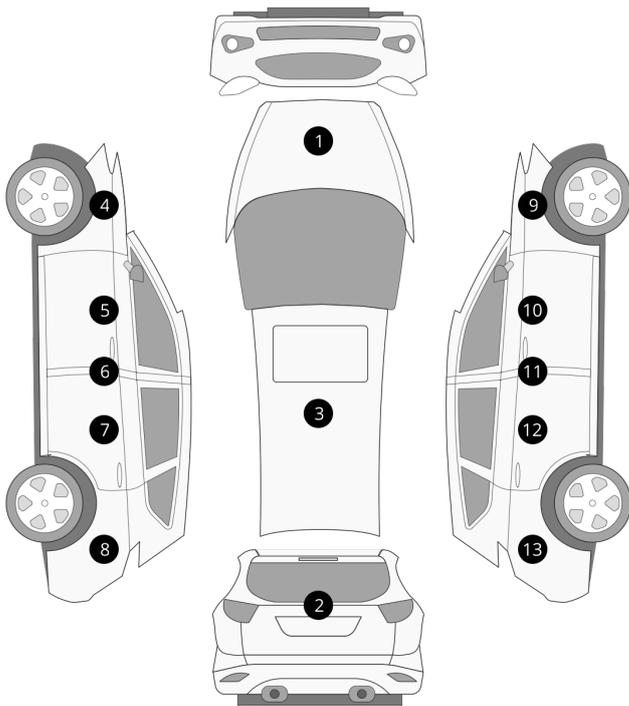


General Information

Date & Time: 02, May, 2025 08:17

Make	Toyota	Model	Vios
YOM	2023	Mileage	31,258
Registration No.	NIH6448	Chassis No.	PA1B18F35P4200756
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



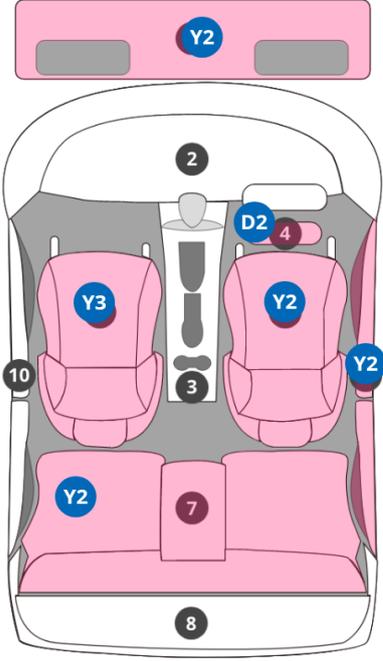
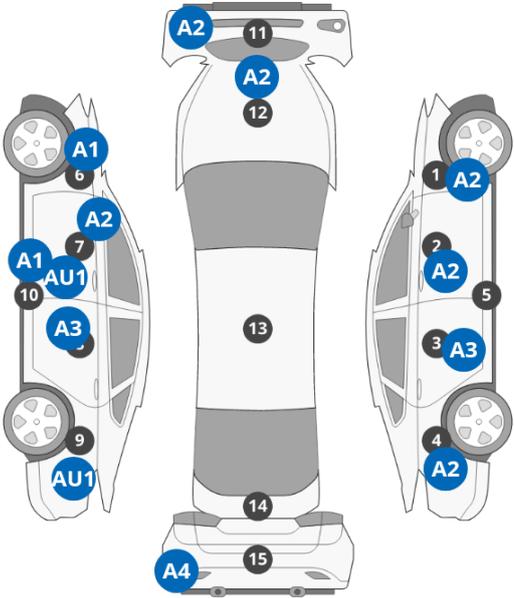
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	106.0	104	103	111
2	Boot Lid	96.8	95	93	102
3	Roof	90.4	95	85	87/94
4	Left Front Fender	97.5	100	101	92
5	Left Front Door	91.5	93	88	94
6	Center Panel Left				
7	Left Rear Door	93.7	99	98	84
8	Left Back Panel	91.1	95	84	94
9	Right Front Fender	98.4	97	100	98
10	Right Front Door	93.6	96	93	92
11	Center Panel Right				
12	Right Rear Door	98.6	93	98	105
13	Right Back Panel	94.8	85	98	101

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Small / (R) Front Trim - Grime - Small / Ceiling - Grime - Small / Rear Seat - Grime - Small / (L) Front Seat - Grime - Medium / (L) Front Floor Mat - Worked - Small</p>	<p>Remarks (L) Rear Fender, Molding - Scratch & Dent - Minimal / (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Large / Front Bumper, Grille, Lamps - Scratch - Small / (L) Rear Door, Molding - Scratch - Medium</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>Without warranty booklet, spare tire, jack, tools and seat cover. 1 key. With LTO plate.</p>