

General Information

Date & Time: 02, May, 2025 13:19

Make	Mitsubishi	Model	Mirage
YOM	2019	Mileage	46,559
Registration No.	NFU9910	Chassis No.	PAEA13TXKKA009811
CC	1.2	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



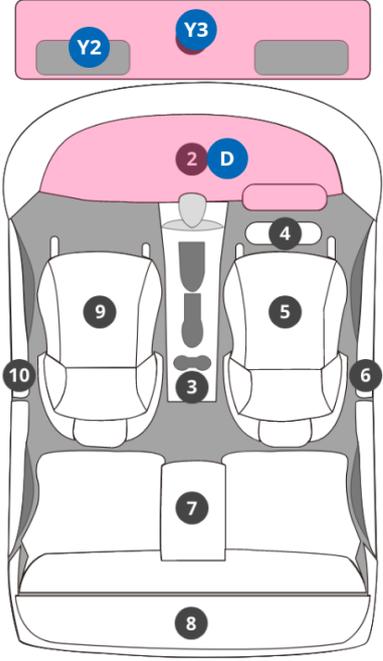
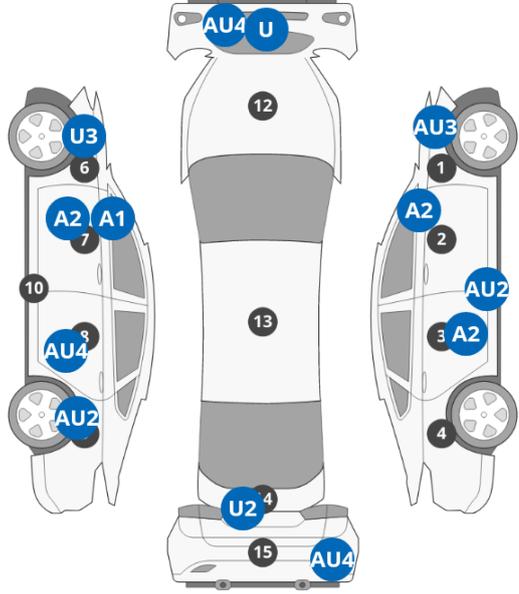
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	235.6	201	204	302
2	Boot Lid	167.6	162	169	172
3	Roof	101.8	91	101	106/109
4	Left Front Fender	260.6	223	246	313
5	Left Front Door	138.3	151	131	133
6	Center Panel Left				
7	Left Rear Door	139.0	140	140	137
8	Left Back Panel	143.6	144	145	142
9	Right Front Fender	313.0	330	310	299
10	Right Front Door	109.0	110	105	112
11	Center Panel Right				
12	Right Rear Door	104.6	102	104	108
13	Right Back Panel	140.0	154	136	130

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes / Sunvisor, Sunglass Holder - Grime - Small</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (L) Front Fender, Molding - Dent - Medium / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / Trunk Hood, Rear Gate - Dent - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Member (Bolted) - Dent - Yes / (R) Mirror - Scratch - Small</p>
Frame Evaluation : B	Functional Evaluation : A
<p>Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>Without warranty booklet, jack and tools. With spare tire and seat cover. 1 key. Gap at front and rear bumper. small crack at headlight. With LTO plate.</p>