

General Information

Date & Time: 03, Jun, 2025 10:04

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	23,937
Registration No.	NHR1882	Chassis No.	PA1B18F32P4227431
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



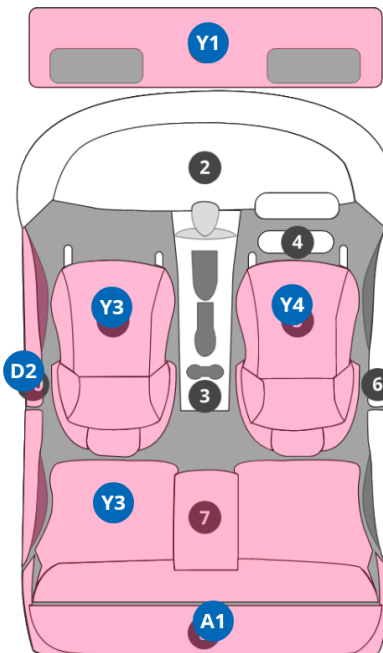
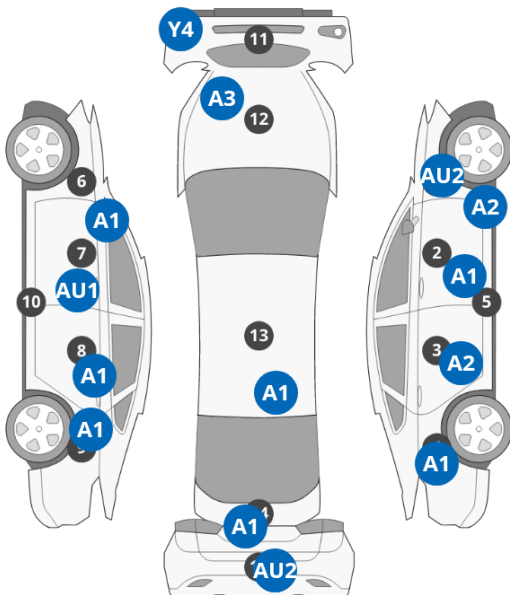
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	115.0	120	102	123
2	Boot Lid	104.6	101	106	107
3	Roof	109.2	105	104	109/119
4	Left Front Fender	101.7	104	99	102
5	Left Front Door	101.5	98	102	105
6	Center Panel Left				
7	Left Rear Door	108.6	117	106	103
8	Left Back Panel	111.6	122	106	107
9	Right Front Fender	102.1	104	99	104
10	Right Front Door	102.7	107	98	103
11	Center Panel Right				
12	Right Rear Door	107.4	98	104	120
13	Right Back Panel	108.0	109	100	115

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Trunk Room - Worn, Scratch, Cut, Crack - Minimal / (R) Front Seat - Grime - Large / Rear Seat - Grime - Medium / (L) Front Trim - Worked - Small / (L) Front Seat - Grime - Medium / Ceiling - Grime - Minimal</p>	<p>Remarks (R) Front Fender, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Rear Door, Molding - Scratch - Minimal / Roof - Scratch - Minimal / (L) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Crack, Gap - Large / Bonnet, Headlight - Scratch - Medium</p>
Frame Evaluation : A	Functional Evaluation : C
<p>Remarks Defects not found</p>	<p>Remarks Power Steering - Issue - Yes / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no LTO plate, with warranty booklet, no jack and tools, no spare tire, fog lamp cover missing</p>