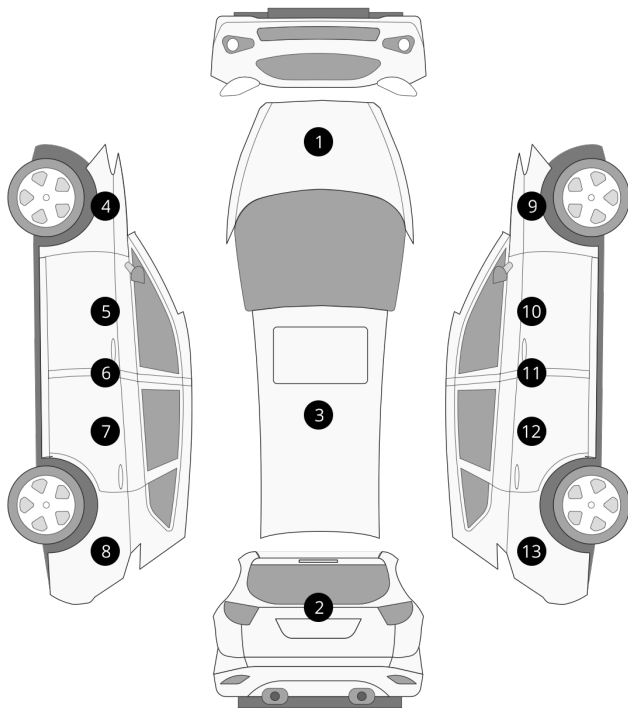


General Information

Date & Time: 01, Jul, 2025 14:49

Make	Toyota	Model	Innova
YOM	2024	Odo Meter Reading	42,811
Registration No.	DBO1307	Chassis No.	PA2JA8EM8P0133157
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	SUV
Colour	Silver		

Body / Panel Condition



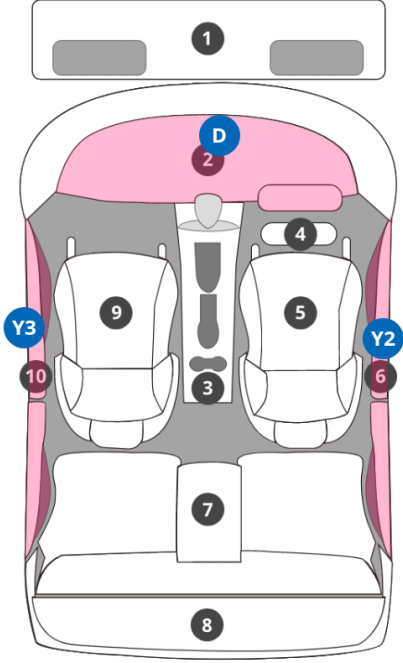
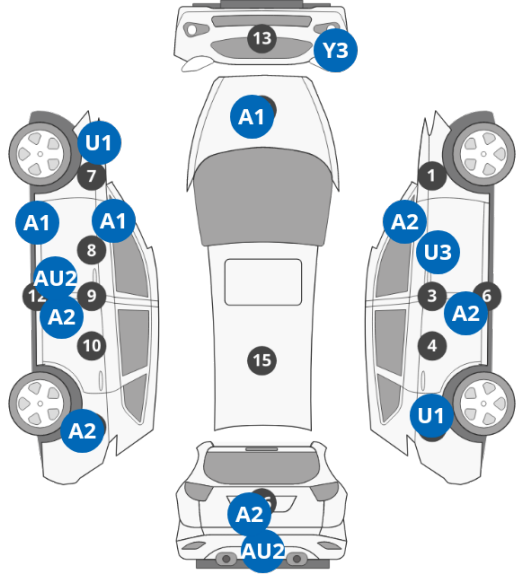
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	108.4	99	127	100
2	Boot Lid	107.0	110	101	110
3	Roof	108.0	107	113	109/103
4	Left Front Fender	180.6	171	186	185
5	Left Front Door	112.6	112	110	116
6	Center Panel Left				
7	Left Rear Door	116.6	122	117	111
8	Left Back Panel	115.6	113	123	111
9	Right Front Fender	111.6	101	128	106
10	Right Front Door	116.6	115	122	113
11	Center Panel Right				
12	Right Rear Door	115.6	108	115	124
13	Right Back Panel	116.0	115	122	111

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Trim - Grime - Medium / (R) Front Trim - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes	Remarks (L) Front Fender - Repair Traces - Yes / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Dent - Medium / (R) Rear Fender, Molding - Dent - Minimal / (R) Rear Door, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Front Fender, Molding - Dent - Minimal / Front Bumper, Grille, Lamps - Crack, Gap - Medium / Bonnet, Headlight - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes

Inspector Notes
with warranty booklet, with jack and tools, with spare tire, with LTO plate, cracked tail light, dome light issue, scratches on headlight and tail light