

General Information

Date & Time: 05, Oct, 2024 15:44

Make	Toyota	Model	Vios
YOM	2024	Mileage	12,983
Registration No.	NHM1751	Chassis No.	PA1B18F35P4237239
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Super Red V		

Body / Panel Condition



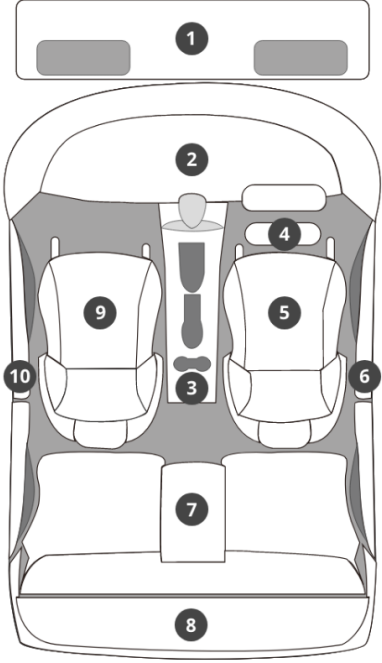
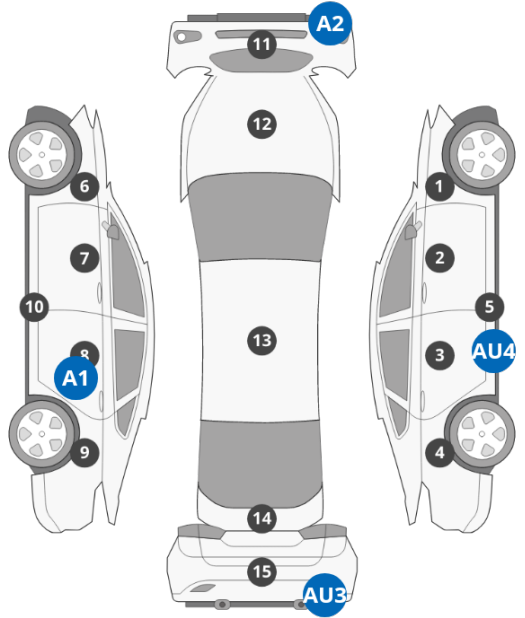
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	128.0	126	126	132
2	Boot Lid	127.6	123	130	130
3	Roof	125.2	153	116	112/120
4	Left Front Fender	117.3	117	116	119
5	Left Front Door	172.3	151	152	214
6	Center Panel Left				
7	Left Rear Door	221.6	218	212	235
8	Left Back Panel	232.3	256	220	221
9	Right Front Fender	138.3	129	117	169
10	Right Front Door	119.6	122	119	118
11	Center Panel Right				
12	Right Rear Door	127.3	130	123	129
13	Right Back Panel	138.3	138	125	152

Overall Evaluation :

A

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Defects not found	Remarks (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Front Bumper, Grille, Lamps - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
hairline around the vehicle