

General Information

Date & Time: 08, May, 2025 12:44

Make	Toyota	Model	Vios
YOM	2021	Mileage	47,816
Registration No.	NDZ5584	Chassis No.	PA1B18F36M4138411
CC	1.3	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



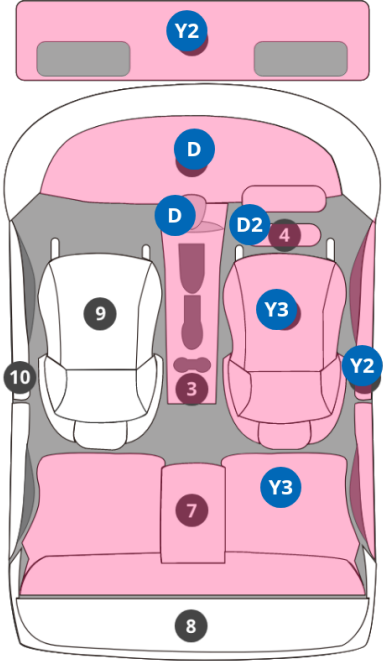
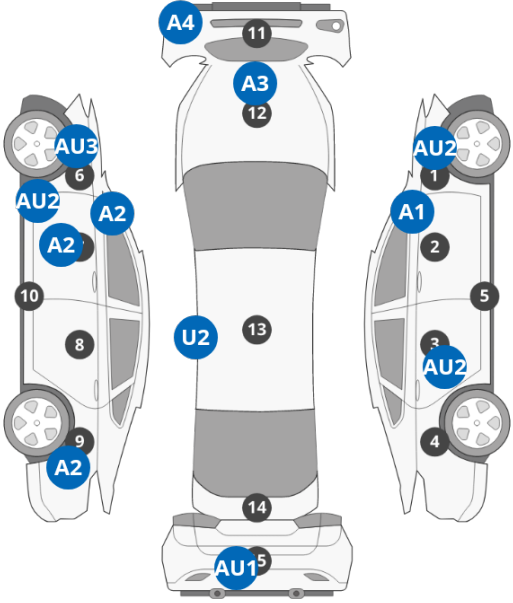
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	134.6	149	125	130
2	Boot Lid	99.2	98	100	100
3	Roof	87.9	92	88	88/83
4	Left Front Fender	297.6	303	298	292
5	Left Front Door	194.0	212	186	184
6	Center Panel Left				
7	Left Rear Door	273.6	297	261	263
8	Left Back Panel	243.3	257	217	256
9	Right Front Fender	98.9	99	100	98
10	Right Front Door	100.2	103	103	95
11	Center Panel Right				
12	Right Rear Door	97.3	96	97	100
13	Right Back Panel	103.3	95	101	114

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes / (R) Front Trim - Grime - Small / Rear Seat - Grime - Medium / (L) Front Floor Mat - Worked - Small / Ceiling - Grime - Small / Console, Switches, Vents - Traces of Adhesive Tape - Yes</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Scratch - Large / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Small / Roof - Dent - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Minimal / (R) Front Fender, Molding - Scratch & Dent - Small / Bonnet, Headlight - Scratch - Medium</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes</p>

<p>Inspector Notes</p>
<p>Without warranty booklet, tools and seat cover. With spare tire and jack. 2 keys. With LTO plate.</p>