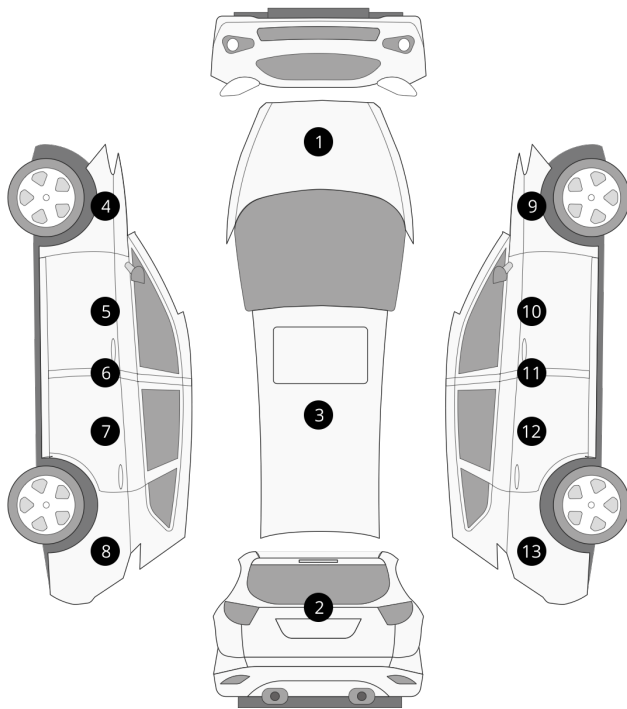


General Information

Date & Time: 09, May, 2025 07:54

Make	Toyota	Model	Hiace
YOM	2020	Mileage	65,192
Registration No.	NEU5948	Chassis No.	JTFJT02P6K0013822
CC	3.0	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	Silver		

Body / Panel Condition



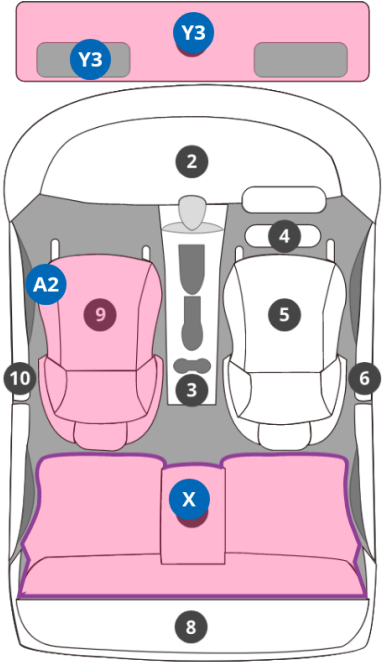
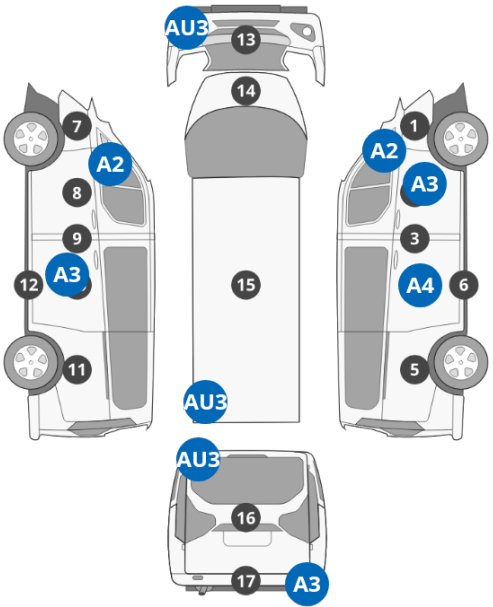
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	167.0	132	192	177
2	Boot Lid	125.3	117	136	123
3	Roof	109.3	91	111	117/118
4	Left Front Fender	111.6	111	112	112
5	Left Front Door	154.3	129	189	145
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	155.3	183	151	132
9	Right Front Fender	114.6	115	117	112
10	Right Front Door	116.0	108	111	129
11	Center Panel Right				
12	Right Rear Door	194.0	195	189	198
13	Right Back Panel	149.3	160	137	151

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Medium / Rear Seat - Partially Missing - Yes / Sunvisor, Sunglass Holder - Grime - Medium / (L) Front Seat - Cut, Crack - Small	Remarks (R) Rear Door - Repair Traces - Yes / (L) Mirror - Scratch - Small / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Large / (L) Rear Door, Molding - Scratch - Medium / Roof - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes

Without warranty booklet and spare tire. Without jack and tools. 1 key. Without LTO plate.