

General Information

Date & Time: 09, May, 2025 15:57

Make	Suzuki	Model	Vitara
YOM	2019	Mileage	89,132
Registration No.	MAI1793	Chassis No.	TSMYD21S0KM485160
CC	1.6	Transmission	A/T
Fuel Type	Gas	Type of Body	SUV
Colour	Orange		

Body / Panel Condition



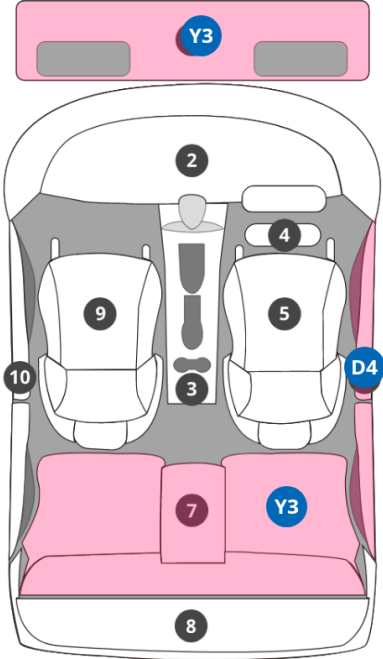
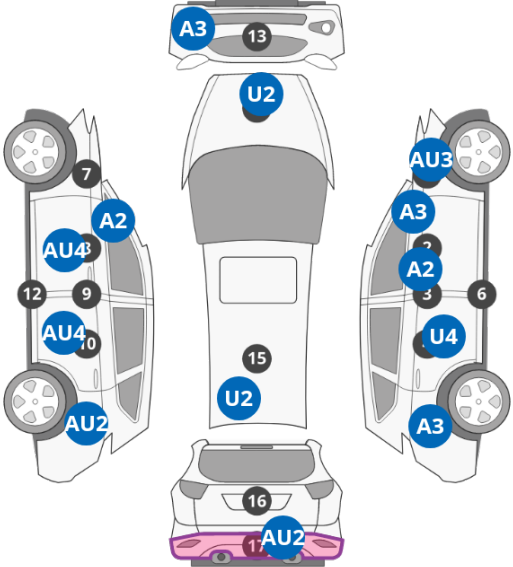
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	183.6	179	187	185
2	Boot Lid	139.6	140	139	140
3	Roof	145.7	138	138	163/144
4	Left Front Fender	155.6	158	156	153
5	Left Front Door	163.0	163	161	165
6	Center Panel Left				
7	Left Rear Door	155.6	156	155	156
8	Left Back Panel	176.3	177	173	179
9	Right Front Fender	159.0	165	160	152
10	Right Front Door	162.6	159	165	164
11	Center Panel Right				
12	Right Rear Door	163.6	154	166	171
13	Right Back Panel	175.3	173	171	182

Overall Evaluation :

D

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Medium / (R) Front Trim - Worked - Large / Rear Seat - Grime - Medium</p>	<p>Remarks Bonnet - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (L) Front Door, Molding - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Mirror - Scratch - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Dent - Large / (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Mirror - Scratch - Medium / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / Roof - Dent - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Dent - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Medium</p>
Frame Evaluation : A	Functional Evaluation : C
<p>Remarks Defects not found</p>	<p>Remarks Power Window (each) - Stuck, Gap - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>driver side door issue cannot open. 2 rear passenger door issue. trunk stay issue. With warranty booklet, spare tire, tools and jack. Without seat cover. 1 key. With LTO plate. one tire flat.</p>