

General Information

Date & Time: 02, Jun, 2025 14:35

Make	Toyota	Model	Hilux
YOM	2021	Odo Meter Reading	107,791
Registration No.	NGA6998	Chassis No.	MR0BA8CD6L0235141
CC	2.8	Transmission	M/T
Fuel Type	Diesel	Type of Body	Pickup
Colour	White		

Body / Panel Condition



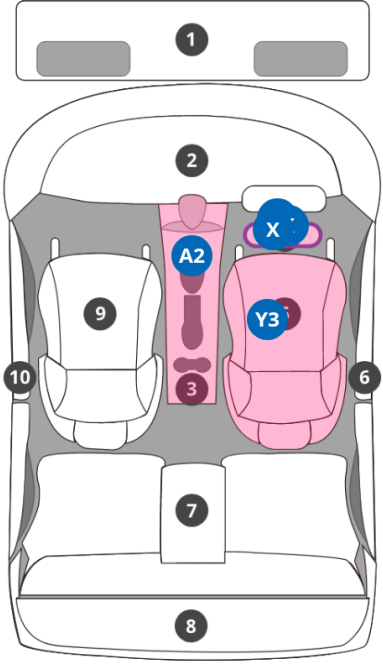
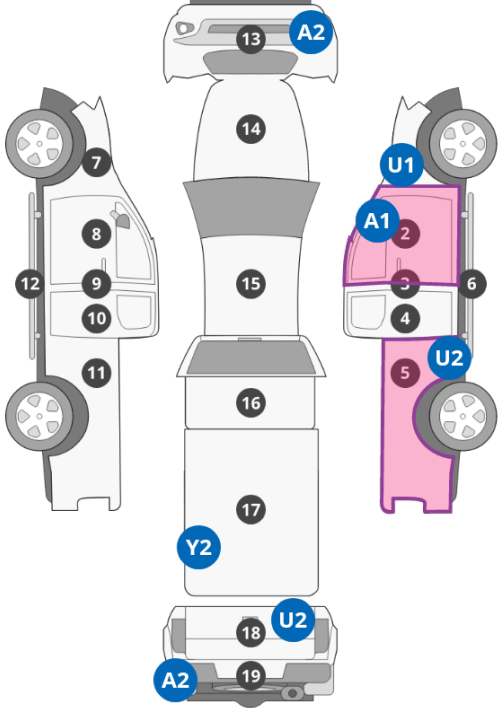
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	104.9	106	113	96
2	Boot Lid	214.3	299	190	154
3	Roof	106.2	107	103	110/105
4	Left Front Fender	91.8	88	92	95
5	Left Front Door	94.3	90	97	97
6	Center Panel Left				
7	Left Rear Door	84.8	81	82	92
8	Left Back Panel	104.3	101	109	103
9	Right Front Fender	94.8	102	96	87
10	Right Front Door	138.3	156	133	126
11	Center Panel Right				
12	Right Rear Door	250.3	307	257	187
13	Right Back Panel	230.3	277	216	198

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : B
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Mat Other - Missing - Yes / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / (R) Front Seat - Grime - Medium / Knobs - Worn, Peel, Crack - Small / Overall Interior - Worn as per age - Yes</p>	<p>Remarks (R) Rear Door - Repair Traces - Yes / (R) Side Gate - Repair mark - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Dent - Minimal / (R) Side Gate - Dent - Small / Cargo Bed Floor - Crack, Gap - Small / Rear Gate - Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Lamps (Brake, Tail, Fog) - Issue - Yes / Horn - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no warranty booklet, no jack, no tools, with spare tire, with LTO plate, plate light issue, horn issue</p>