

General Information

Date & Time: 03, Jun, 2025 12:51

Make	Toyota	Model	Vios
YOM	2020	Odo Meter Reading	77,368
Registration No.	DBA5757	Chassis No.	PA1B18F30L4116919
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



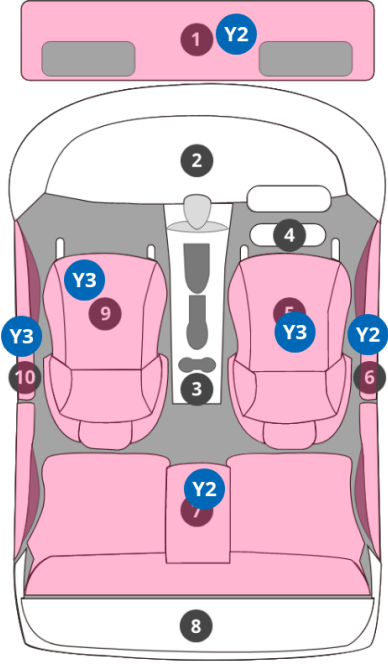
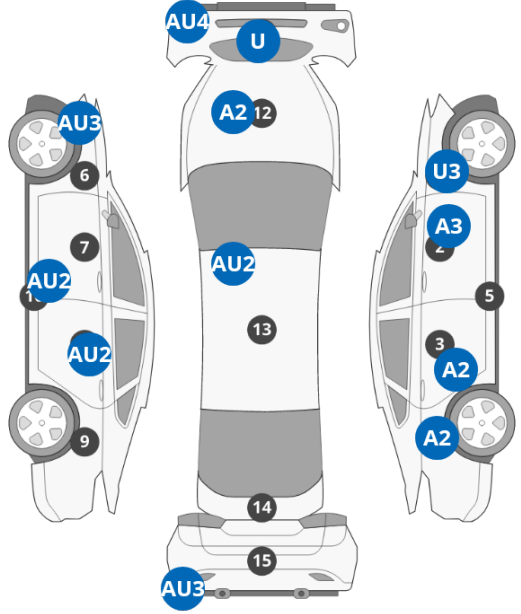
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.3	109	107	118
2	Boot Lid	112.6	113	108	117
3	Roof	106.2	111	101	113/100
4	Left Front Fender	92.7	98	90	91
5	Left Front Door	100.6	100	99	103
6	Center Panel Left				
7	Left Rear Door	148.5	110	236	100
8	Left Back Panel	110.3	115	109	107
9	Right Front Fender	99.3	100	100	98
10	Right Front Door	101.1	103	103	97
11	Center Panel Right				
12	Right Rear Door	98.6	90	96	110
13	Right Back Panel	106.3	99	102	118

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Medium / Rear Seat - Grime - Small / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Medium / Ceiling - Grime - Small</p>	<p>Remarks (L) Rear Door - Repair Traces - Yes / (R) Front Fender, Molding - Dent - Medium / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Member (Bolted) - Dent - Yes / Bonnet, Headlight - Scratch - Small / Roof - Scratch & Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes</p>

<p>Inspector Notes</p>
<p>with warranty booklet, with jack, incomplete tools, with spare tire, with LTO plate, scratch and crack tail light,</p>