

General Information

Date & Time: 02, Jun, 2025 15:35

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	29,272
Registration No.	NFR5289	Chassis No.	PA1B18F38R4252109
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



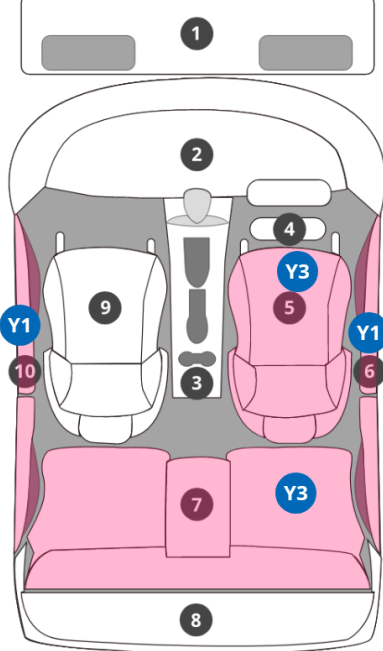
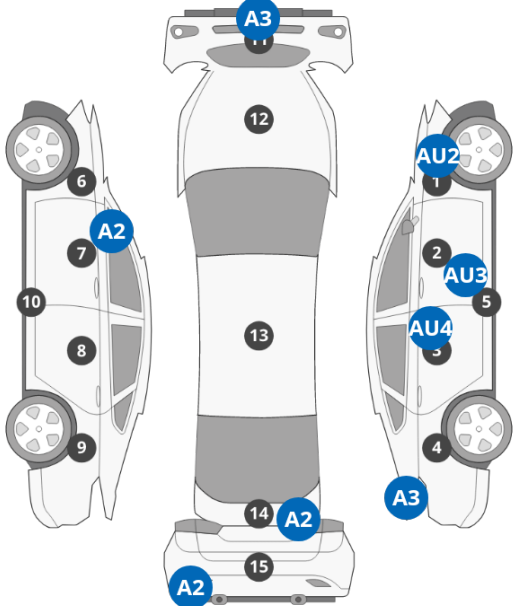
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.6	119	108	111
2	Boot Lid	104.3	105	100	108
3	Roof	106.2	103	110	101/111
4	Left Front Fender	99.7	102	100	98
5	Left Front Door	101.6	103	103	99
6	Center Panel Left				
7	Left Rear Door	101.8	110	99	97
8	Left Back Panel	112.3	113	112	112
9	Right Front Fender	98.6	97	97	102
10	Right Front Door	107.3	105	105	112
11	Center Panel Right				
12	Right Rear Door	111.3	107	106	121
13	Right Back Panel	114.0	113	109	120

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / (R) Front Trim - Grime - Minimal / (L) Front Trim - Grime - Minimal</p>	<p>Remarks (R) Front Fender, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / (R) Rear Fender, Molding - Scratch - Medium / (L) Mirror - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium</p>
Frame Evaluation : A	Functional Evaluation : C
<p>Remarks Defects not found</p>	<p>Remarks Power Steering - Issue - Yes / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no warranty booklet, with jack and tools, with spare tire, with LTO plate, weak battery, power steering issue due to weak battery</p>