

General Information

Date & Time: 01, Jul, 2025 18:43

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	33,108
Registration No.	NHH4229	Chassis No.	PA1B18F35R4257316
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



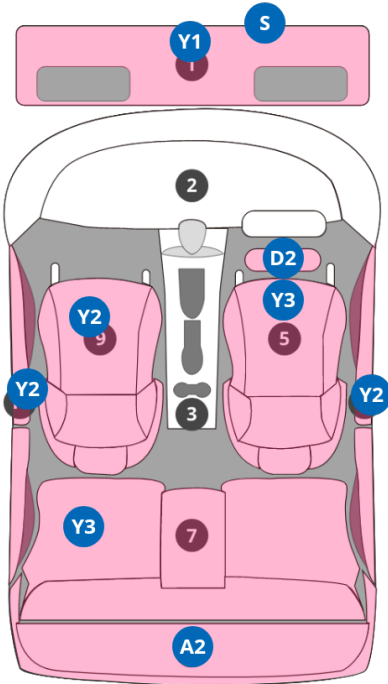
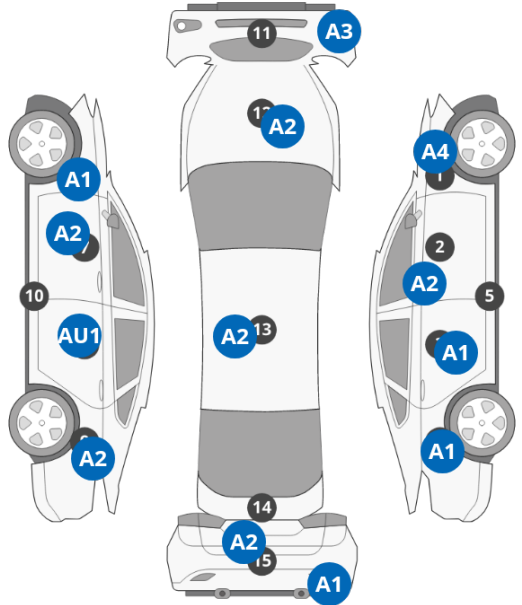
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	119.3	117	113	128
2	Boot Lid	118.0	111	110	133
3	Roof	106.1	106	103	100/116
4	Left Front Fender	108.6	110	106	110
5	Left Front Door	112.0	117	110	109
6	Center Panel Left				
7	Left Rear Door	107.0	103	111	107
8	Left Back Panel	114.6	120	117	107
9	Right Front Fender	110.3	114	103	114
10	Right Front Door	116.3	111	111	127
11	Center Panel Right				
12	Right Rear Door	114.6	105	122	117
13	Right Back Panel	119.3	113	110	135

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Trunk Room - Worn, Scratch, Cut, Crack - Small / Rear Seat - Grime - Medium / (R) Front Seat - Grime - Medium / (L) Front Trim - Grime - Small / Overall Interior - Smell - Yes / (L) Front Floor Mat - Worked - Small / (R) Front Trim - Grime - Small / (L) Front Seat - Grime - Small / Ceiling - Grime - Minimal	Remarks (R) Front Fender, Molding - Scratch - Large / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Minimal / Roof - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Small
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Power Steering - Issue - Yes / Battery - Weak - Yes

Inspector Notes
with LTO plate, with warranty booklet, with jack, incomplete tools, with spare tire, weak battery