

General Information

Date & Time: 03, Jun, 2025 08:51

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	9,179
Registration No.	NKC8595	Chassis No.	PA1B18F33R4257038
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



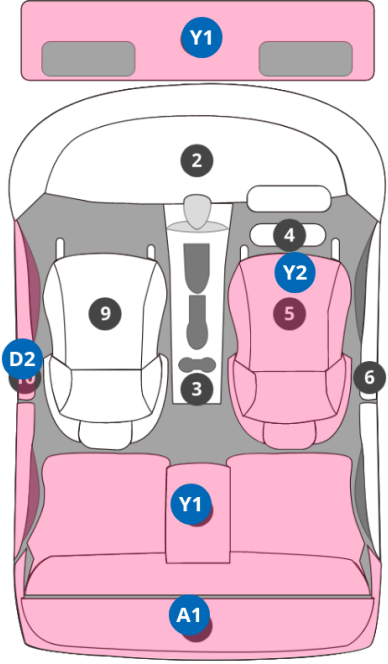
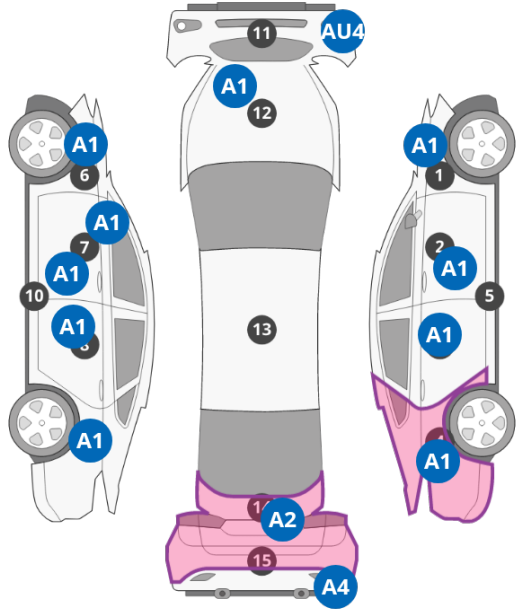
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	115.6	122	104	121
2	Boot Lid	183.3	187	164	199
3	Roof	104.2	119	103	90/105
4	Left Front Fender	101.2	100	96	108
5	Left Front Door	101.2	101	99	104
6	Center Panel Left				
7	Left Rear Door	106.3	115	105	99
8	Left Back Panel	97.1	102	94	95
9	Right Front Fender	96.5	97	95	97
10	Right Front Door	96.7	94	93	103
11	Center Panel Right				
12	Right Rear Door	102.5	100	95	113
13	Right Back Panel	167.6	187	150	166

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Small / Trunk Room - Worn, Scratch, Cut, Crack - Minimal / Rear Seat - Grime - Minimal / (L) Front Trim - Worked - Small / Ceiling - Grime - Minimal</p>	<p>Remarks Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Fender, Molding - Repair mark - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no LTO plate, with warranty booklet, with jack, no tools, with spare tire, busted plate light</p>