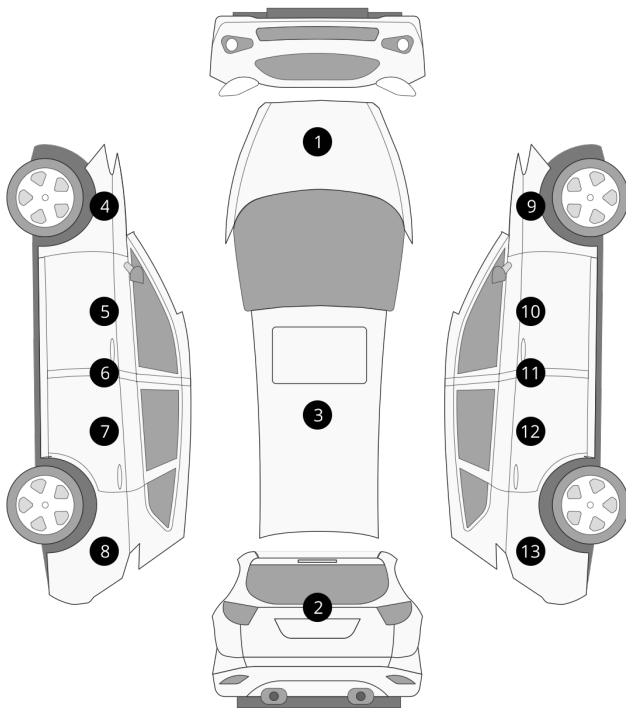


General Information

Date & Time: 15, Oct, 2024 10:59

Make	Toyota	Model	Vios
YOM	2022	Mileage	45,598
Registration No.	NHB7031	Chassis No.	PA1B18F39N4179326
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Gray		

Body / Panel Condition



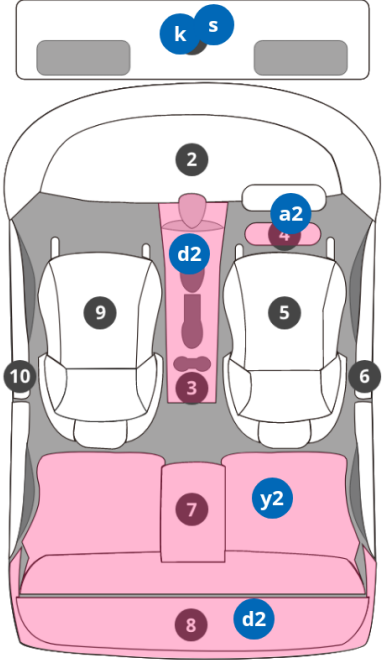
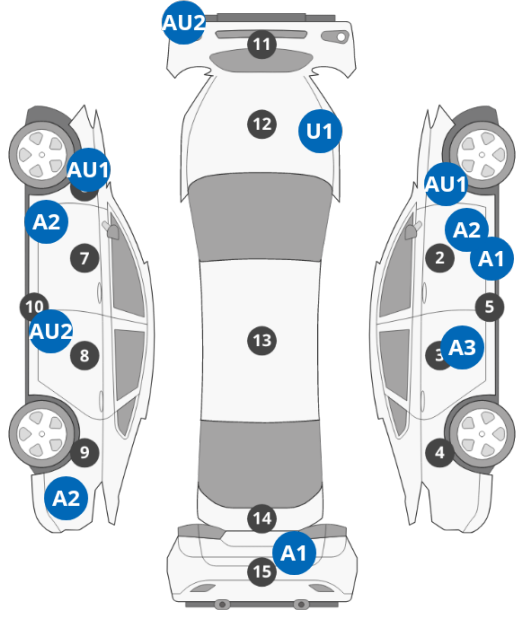
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	117.3	118	115	119
2	Boot Lid	112.0	111	114	111
3	Roof	222.2	227	218	222/222
4	Left Front Fender	107.6	110	106	107
5	Left Front Door	113.6	111	116	114
6	Center Panel Left				
7	Left Rear Door	113.3	112	117	111
8	Left Back Panel	115.0	123	114	108
9	Right Front Fender	98.8	99	100	98
10	Right Front Door	101.0	107	97	99
11	Center Panel Right				
12	Right Rear Door	100.0	95	97	108
13	Right Back Panel	102.1	98	101	108

Overall Evaluation :

A

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Console, Switchs, Vents - Loose, Deformed, Grime - Small / (L) Front Floor Lag - Cut, Crack - Small / Trunk Room - Loose, Deformed, Grime - Small / Rear Seat - Grime - Small / Overall Interior - Animal Hair - Yes / Overall Interior - Smell - Yes	Remarks Roof - Repair Traces - Yes / (L) Front Fender, Molding - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch & Dent - Minimal / Bonnet, Headlight - Dent - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
roof was repainted to black. more minimal scratches at trunk door. more light scratches around the exterior. rightside reverselight issue. flip key issue.