

General Information

Date & Time: 31, May, 2025 10:46

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	5,998
Registration No.	NFR1217	Chassis No.	PA1B18F3XR4247445
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



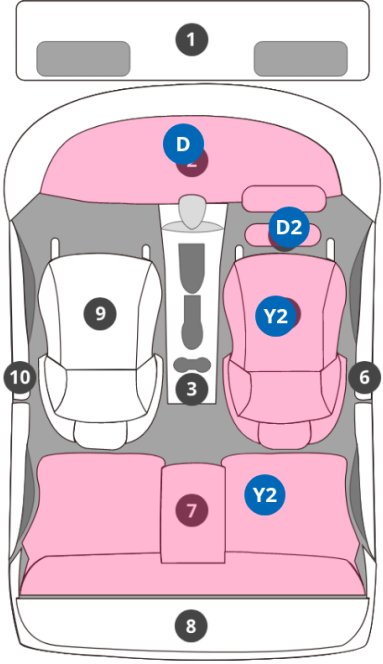
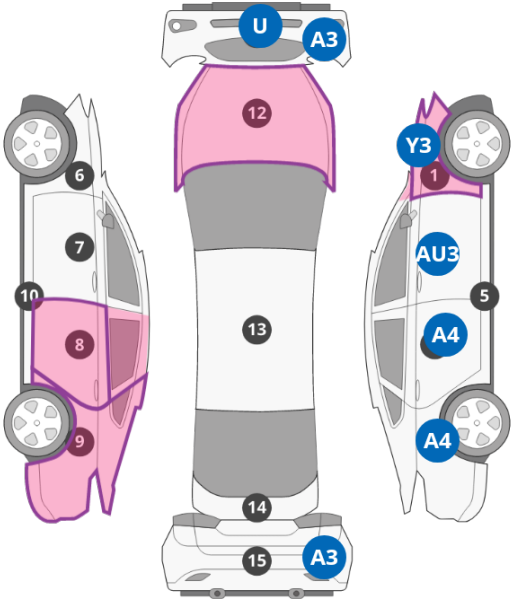
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	263.0	124	538	127
2	Boot Lid	105.6	104	105	108
3	Roof	107.3	113	107	97/112
4	Left Front Fender	95.0	101	95	90
5	Left Front Door	138.3	128	126	161
6	Center Panel Left				
7	Left Rear Door	182.6	161	215	172
8	Left Back Panel	171.6	176	166	173
9	Right Front Fender	171.0	164	173	176
10	Right Front Door	99.9	100	103	97
11	Center Panel Right				
12	Right Rear Door	107.0	100	105	116
13	Right Back Panel	99.3	99	99	100

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Small / Rear Seat - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / (L) Front Floor Mat - Worked - Small</p>	<p>Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Member (Bolted) - Dent - Yes / Bonnet, Headlight - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / (R) Front Fender, Molding - Crack, Gap - Medium / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch - Large / Trunk Hood, Rear Gate - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Medium</p>
Frame Evaluation : B	Functional Evaluation : A
<p>Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With warranty booklet and LTO plate and sparetire, Incomplete tools. no jack, scratch tail light.</p>