

General Information

Date & Time: 03, Jun, 2025 15:51

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	14,909
Registration No.	DBO2337	Chassis No.	PA1B18F36P4236942
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



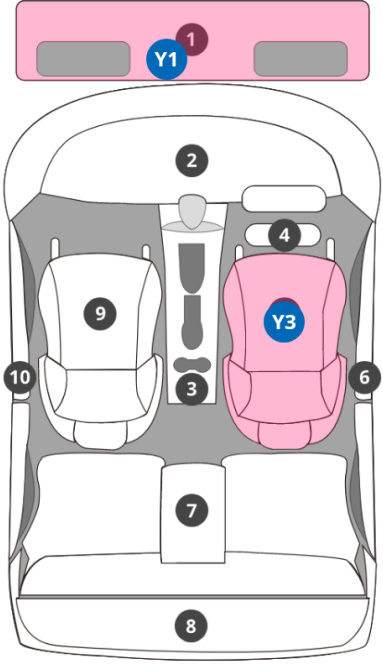
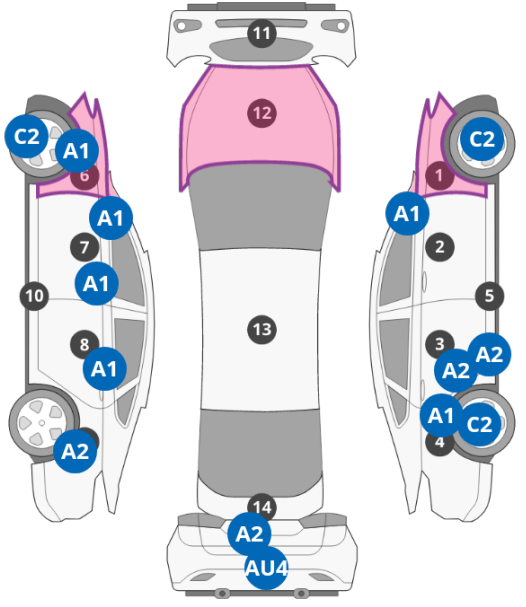
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	160.6	179	146	157
2	Boot Lid	117.3	120	106	126
3	Roof	113.5	106	126	110/112
4	Left Front Fender	153.0	159	145	155
5	Left Front Door	99.5	99	100	100
6	Center Panel Left				
7	Left Rear Door	113.0	118	113	108
8	Left Back Panel	118.0	113	138	103
9	Right Front Fender	99.8	109	93	97
10	Right Front Door	149.0	143	134	170
11	Center Panel Right				
12	Right Rear Door	118.3	115	115	125
13	Right Back Panel	124.6	122	118	134

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks (R) Front Seat - Grime - Medium / Ceiling - Grime - Minimal	Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (R) Mirror - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / (R) Front Wheel, Cover - Scratch, Corrosion - Small / (R) Rear Wheel, Cover - Scratch, Corrosion - Small / (L) Front Wheel, Cover - Scratch, Corrosion - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate, no warranty booklet, with jack and incomplete tools, with spare tire, no reverse camera