

General Information

Date & Time: 31, May, 2025 15:40

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	19,787
Registration No.	EAG6908	Chassis No.	PA1B18F37P4232348
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



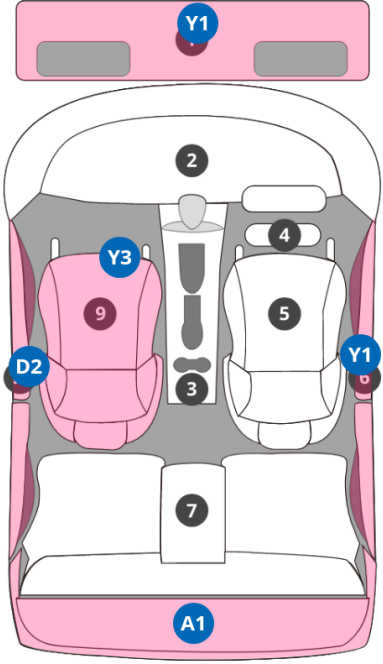
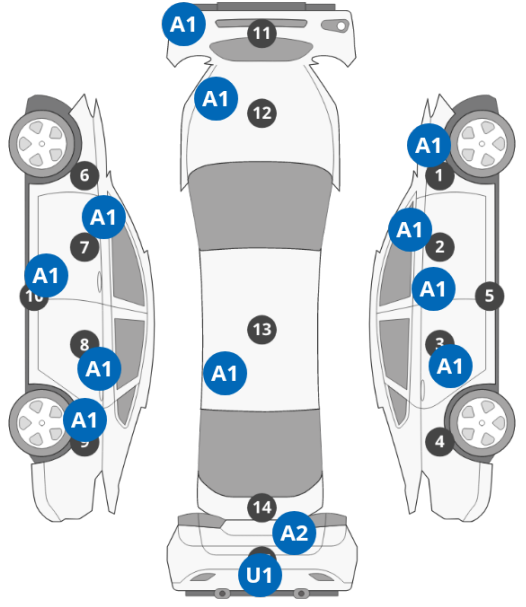
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	124.0	131	108	133
2	Boot Lid	138.3	139	124	152
3	Roof	105.2	103	115	102/101
4	Left Front Fender	127.3	141	139	102
5	Left Front Door	166.6	166	163	171
6	Center Panel Left				
7	Left Rear Door	130.6	110	140	142
8	Left Back Panel	106.6	113	105	102
9	Right Front Fender	146.0	160	128	150
10	Right Front Door	101.2	107	97	100
11	Center Panel Right				
12	Right Rear Door	102.4	97	95	116
13	Right Back Panel	114.3	96	99	148

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Trunk Room - Worn, Scratch, Cut, Crack - Minimal / (L) Front Trim - Worked - Small / (L) Front Seat - Grime - Medium / (R) Front Trim - Grime - Minimal / Ceiling - Grime - Minimal</p>	<p>Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Dent - Minimal / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / Roof - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate, with warranty booklet, with jack, no tools, with spare tire, no reverse camera</p>