

## General Information

Date & Time: 03, Jun, 2025 15:08

|                         |                   |                          |                   |
|-------------------------|-------------------|--------------------------|-------------------|
| <b>Make</b>             | Toyota            | <b>Model</b>             | Vios              |
| <b>YOM</b>              | 2023              | <b>Odo Meter Reading</b> | 16,109            |
| <b>Registration No.</b> | NHJ6566           | <b>Chassis No.</b>       | PA1B18F31P4218378 |
| <b>CC</b>               | 1.3               | <b>Transmission</b>      | CVT               |
| <b>Fuel Type</b>        | Gas               | <b>Type of Body</b>      | Sedan             |
| <b>Colour</b>           | Red Mica Metallic |                          |                   |

## Body / Panel Condition



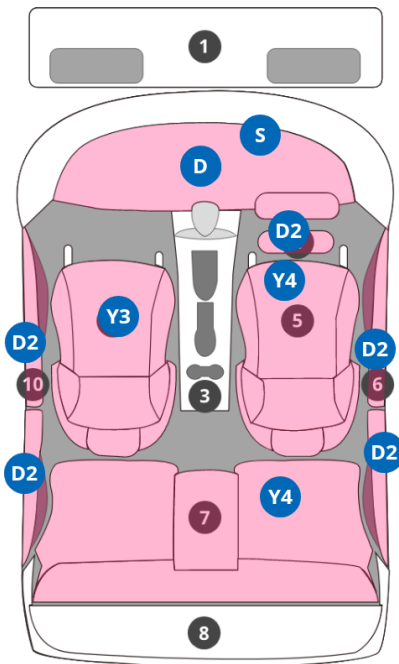
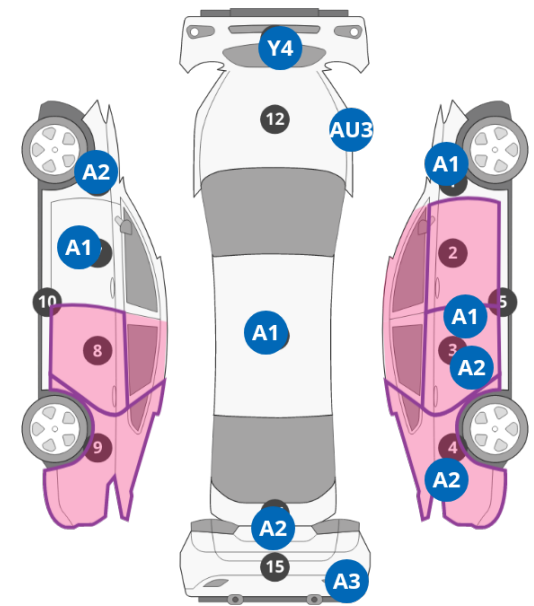
| #  | Area               | Thickness(um) |        |        |          |
|----|--------------------|---------------|--------|--------|----------|
|    |                    | Average       | Value1 | Value2 | Value3/4 |
| 1  | Bonnet             | 113.6         | 112    | 113    | 116      |
| 2  | Boot Lid           | 224.6         | 147    | 308    | 219      |
| 3  | Roof               | 103.7         | 109    | 95     | 100/111  |
| 4  | Left Front Fender  | 148.6         | 158    | 150    | 138      |
| 5  | Left Front Door    | 183.6         | 180    | 162    | 209      |
| 6  | Center Panel Left  |               |        |        |          |
| 7  | Left Rear Door     | 149.6         | 156    | 148    | 145      |
| 8  | Left Back Panel    | 250.3         | 215    | 241    | 295      |
| 9  | Right Front Fender | 139.0         | 141    | 144    | 132      |
| 10 | Right Front Door   | 255.0         | 379    | 205    | 181      |
| 11 | Center Panel Right |               |        |        |          |
| 12 | Right Rear Door    | 180.0         | 171    | 181    | 188      |
| 13 | Right Back Panel   | 314.4         | 124    | 96     | 723      |

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

|   |   |
|---|---|
| <b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>  | <b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">D</span>  |
|  <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>  |  <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>   |
| <p><b>Remarks</b><br/>(L) Front Seat - Grime - Medium / (L) Front Floor Mat - Worked - Small / (L) Front Trim - Worked - Small / Rear Seat - Grime - Large / (R) Front Seat - Grime - Large / Overall Interior - Worn as per age - Yes / Overall Interior - Smell - Yes / (R) Front Trim - Worked - Small / (R) Rear Trim - Worked - Small / (L) Rear Trim - Worked - Small / Dashboard - Traces of Adhesive Tape - Yes</p> | <p><b>Remarks</b><br/>(R) Front Door - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / (L) Rear Fender, Molding - Repair mark - Yes / Bonnet, Headlight - Scratch &amp; Dent - Medium / Front Bumper, Grille, Lamps - Crack, Gap - Large / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Front Door, Molding - Scratch - Minimal / Roof - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small</p> |
| <b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>   | <b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>  |
| <p><b>Remarks</b><br/>Defects not found</p>   | <p><b>Remarks</b><br/>Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>  |

|   |
|---|
| <p><b>Inspector Notes</b></p>   |
| <p>with warranty booklet and Jack,Sparetire. no Tools and LTO plate. scratch crack on headlight. towhook cover ,Missing</p> |