

General Information

Date & Time: 19, Oct, 2024 16:01

Make	Toyota	Model	Hilux
YOM	2024	Mileage	34,068
Registration No.	BAF9270	Chassis No.	MR0JB8DD3P3550412
CC	2.4	Transmission	A/T
Fuel Type	Diesel	Type of Body	Pickup
Colour	Blue		

Body / Panel Condition



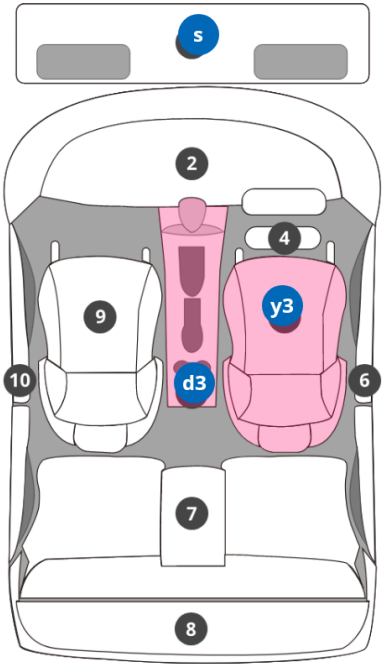
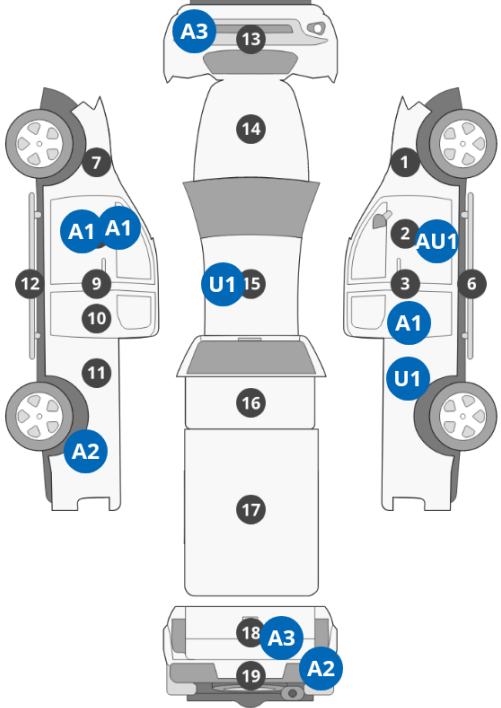
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	125.3	127	128	121
2	Boot Lid	109.3	114	108	106
3	Roof	125.2	120	124	134/123
4	Left Front Fender	115.3	116	120	110
5	Left Front Door	123.6	122	128	121
6	Center Panel Left				
7	Left Rear Door	112.6	116	112	110
8	Left Back Panel	125.6	122	123	132
9	Right Front Fender	113.6	109	117	115
10	Right Front Door	117.3	123	119	110
11	Center Panel Right				
12	Right Rear Door	111.0	100	111	122
13	Right Back Panel	124.6	130	120	124

Overall Evaluation :

A

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Console, Switchs, Vents - Loose, Deformed, Grime - Medium / Overall Interior - Smell - Yes / (R) Front Seat - Grime - Medium	Remarks Front Bumper, Grille, Lamps - Scratch - Medium / (L) Front Door, Molding - Scratch - Minimal / (L) Side Gate - Scratch - Small / Rear Gate - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Side Gate - Dent - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Minimal / (L) Mirror - Scratch - Minimal / Roof - Dent - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
swirl marks and hairline scratches around the exterior. aftermarket mattings. door handle covers. headlight and taillight covers.2