

General Information

Date & Time: 02, Jun, 2025 15:56

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	52,679
Registration No.	CBI7428	Chassis No.	PA1B18F30P4218470
CC	1.3	Transmission	M/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



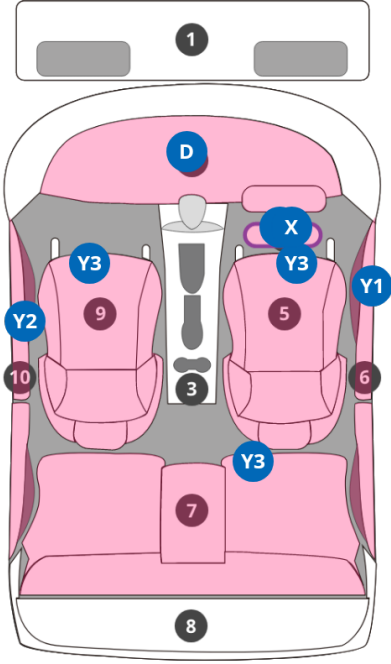
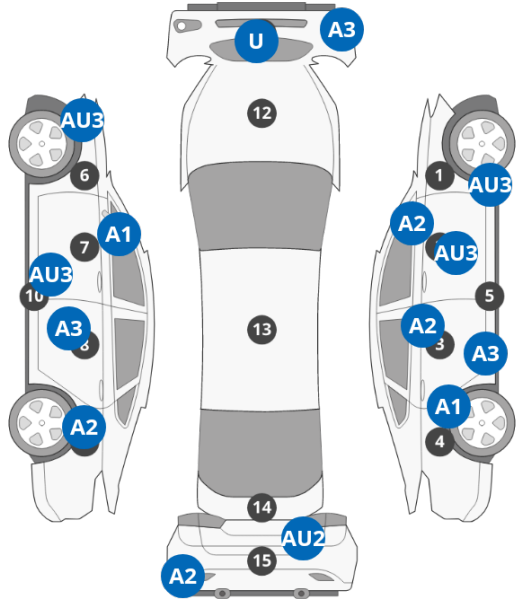
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	115.6	115	112	120
2	Boot Lid	117.3	110	117	125
3	Roof	112.5	114	108	122/106
4	Left Front Fender	104.3	116	101	96
5	Left Front Door	106.6	105	102	113
6	Center Panel Left				
7	Left Rear Door	104.2	114	103	96
8	Left Back Panel	116.6	132	114	104
9	Right Front Fender	106.0	108	102	108
10	Right Front Door	100.1	101	98	101
11	Center Panel Right				
12	Right Rear Door	105.3	99	100	117
13	Right Back Panel	108.0	102	108	114

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / (R) Front Trim - Grime - Minimal / (L) Front Trim - Grime - Small / Mat Other - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Dashboard - Traces of Adhesive Tape - Yes</p>	<p>Remarks (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Mirror - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch & Dent - Medium / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch - Medium</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes</p>

<p>Inspector Notes</p>
<p>no warranty booklet, with jack, incomplete tools, with spare tire, with LTO plate</p>