

General Information

Date & Time: 31, May, 2025 12:35

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	18,747
Registration No.	NKF2095	Chassis No.	PA1B18F34R4268968
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



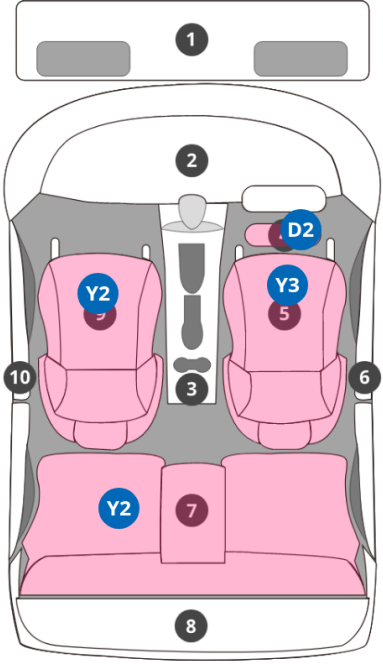
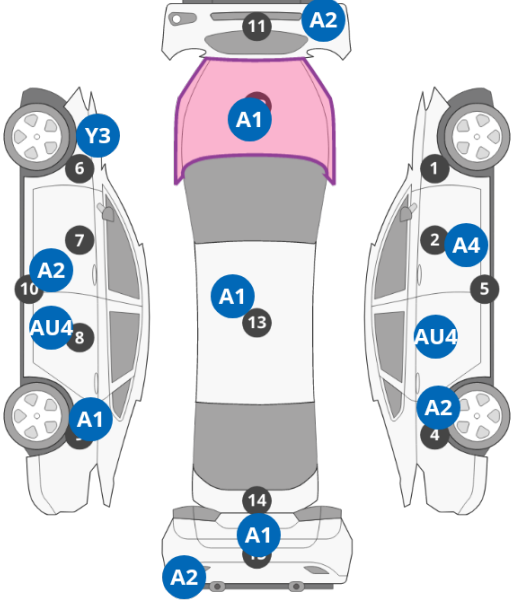
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	108.0	113	115	96
2	Boot Lid	117.3	106	111	135
3	Roof	105.7	100	98	94/131
4	Left Front Fender	91.7	97	91	87
5	Left Front Door	101.8	100	97	108
6	Center Panel Left				
7	Left Rear Door	101.3	110	101	93
8	Left Back Panel	112.3	116	106	115
9	Right Front Fender	100.7	103	100	99
10	Right Front Door	96.8	103	94	94
11	Center Panel Right				
12	Right Rear Door	99.3	92	96	110
13	Right Back Panel	112.0	104	105	127

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Small / (L) Front Seat - Grime - Small / (L) Front Floor Mat - Worked - Small / (R) Front Seat - Grime - Medium</p>	<p>Remarks (R) Rear Door, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch - Small / Bonnet, Headlight - Repair mark - Yes / Bonnet, Headlight - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch - Minimal / (L) Front Fender, Molding - Crack, Gap - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / Roof - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with warranty booklet and LTO plate and Jack, Sparetire and Tools. scratch headlight and tail light.</p>