

General Information

Date & Time: 31, May, 2025 09:45

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	26,740
Registration No.	CBK9799	Chassis No.	PA1B18F35P4220229
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



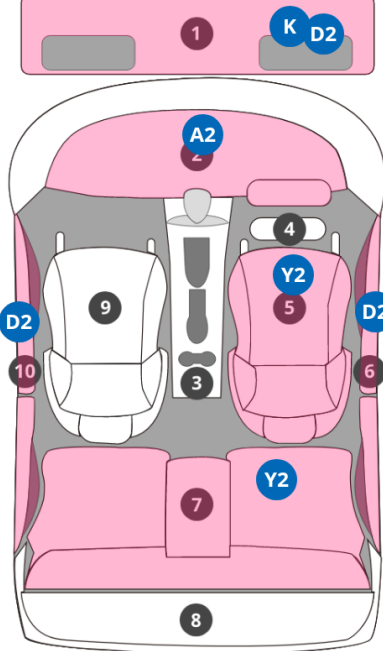
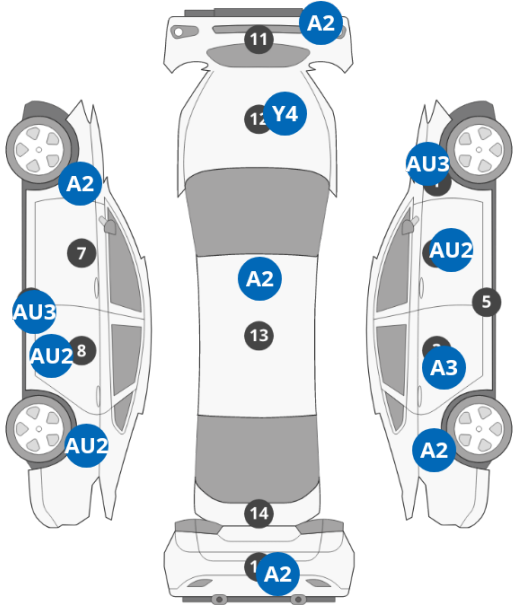
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.6	110	113	106
2	Boot Lid	107.6	106	110	107
3	Roof	107.0	115	98	99/117
4	Left Front Fender	100.2	99	99	103
5	Left Front Door	107.6	105	102	116
6	Center Panel Left				
7	Left Rear Door	107.8	117	111	95
8	Left Back Panel	114.3	121	113	109
9	Right Front Fender	96.8	97	96	98
10	Right Front Door	99.5	103	96	100
11	Center Panel Right				
12	Right Rear Door	106.6	103	104	113
13	Right Back Panel	105.2	104	98	114

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Overall Interior - Worn as per age - Yes / Overall Interior - Animal Hair - Yes / Ceiling - Crinkle - Small / (R) Front Seat - Grime - Small / Rear Seat - Grime - Small / Dashboard - Worn, Scratch, Cut, Crack - Small / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small</p>	<p>Remarks (L) Front Fender, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Door, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Small / Roof - Scratch - Small / Bonnet, Headlight - Crack, Gap - Large / (R) Front Fender, Molding - Scratch & Dent - Medium</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with sparetire and incomplete tools.no warranty booklet and LTO plate, scratches on tail lights and head lights. adhesive mark on rear left side door trim inside.</p>