

General Information

Date & Time: 30, May, 2025 14:01

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	11,314
Registration No.	DBF7102	Chassis No.	PA1B18F35R4250527
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



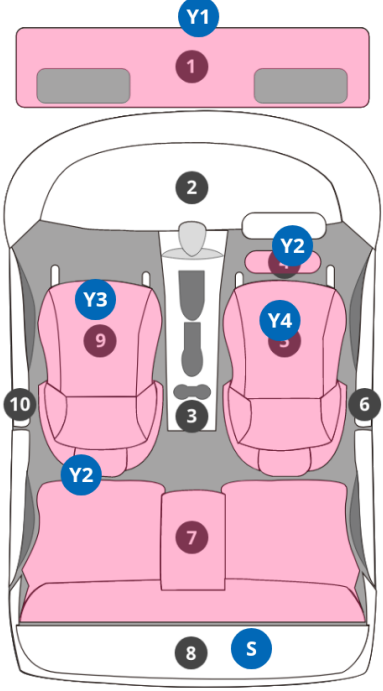
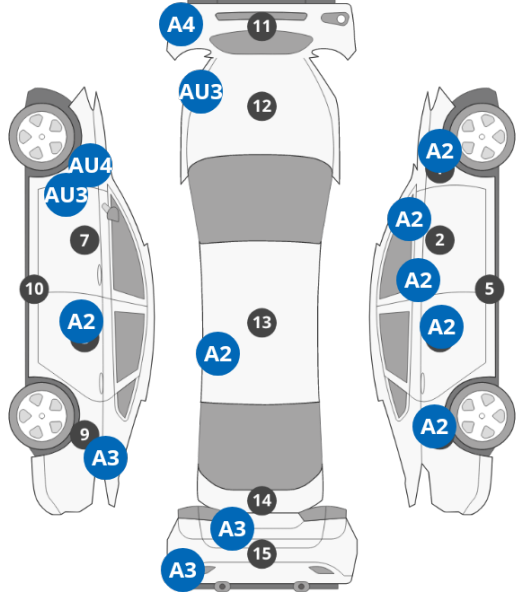
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	123.3	130	120	120
2	Boot Lid	121.0	120	122	121
3	Roof	127.7	120	117	122/152
4	Left Front Fender	125.6	122	121	134
5	Left Front Door	119.6	122	119	118
6	Center Panel Left				
7	Left Rear Door	121.0	121	121	121
8	Left Back Panel	120.6	120	121	121
9	Right Front Fender	123.0	119	119	131
10	Right Front Door	111.3	116	107	111
11	Center Panel Right				
12	Right Rear Door	130.3	143	131	117
13	Right Back Panel	131.3	118	118	158

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Large / (R) Front Floor Mat - Grime - Small / Rear Seat - Grime - Small / (L) Front Seat - Grime - Medium / Ceiling - Grime - Minimal / Overall Interior - Smell - Yes</p>	<p>Remarks (L) Front Fender, Molding - Scratch & Dent - Large / (L) Front Door, Molding - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Scratch - Large / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Medium / (L) Rear Door, Molding - Scratch - Small / Roof - Scratch - Small / Bonnet, Headlight - Scratch & Dent - Medium</p>
Frame Evaluation : B	Functional Evaluation : A
<p>Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Turn Signal, Hazard Flasher - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate, with warranty booklet, with jack, trunk door not opening, left cheek light missing, bent front left wheel, left front door not opening fully, cracked headlights, tail light scratches</p>