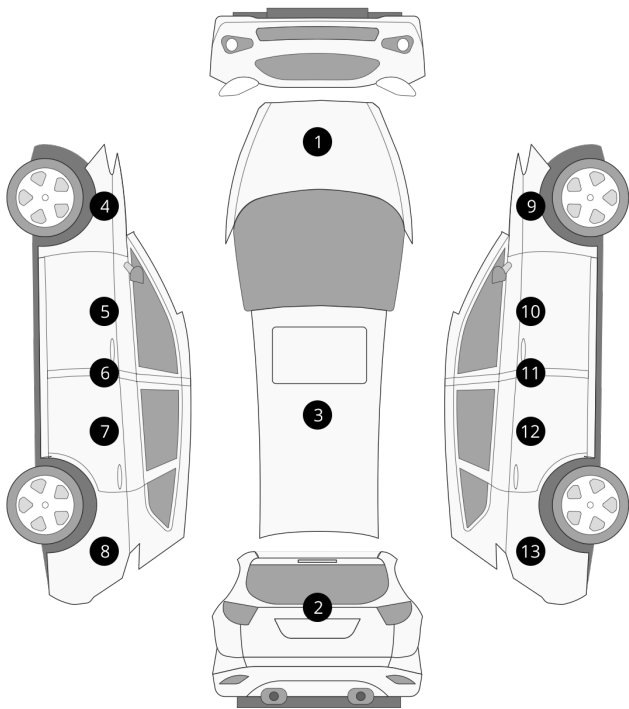


General Information

Date & Time: 30, May, 2025 10:31

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	19,716
Registration No.	DBP6713	Chassis No.	PA1B18F39R4264592
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



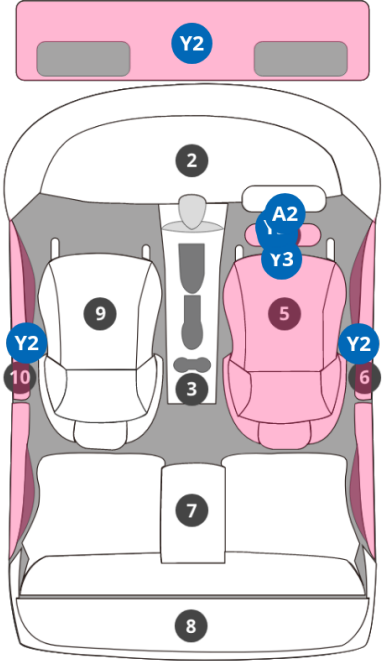
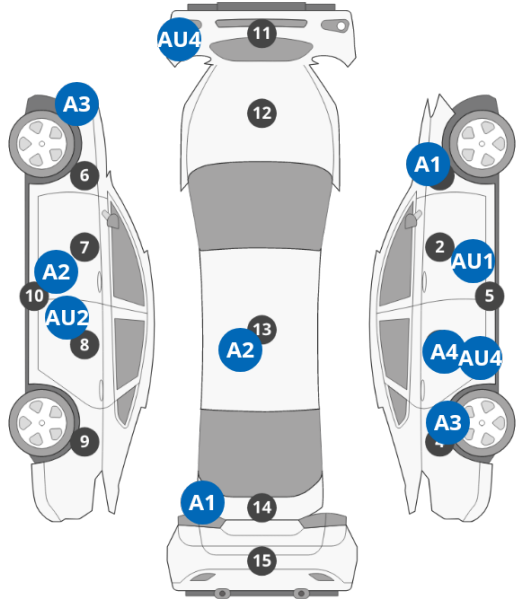
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	121.0	123	122	118
2	Boot Lid	111.0	107	111	115
3	Roof	113.2	120	116	106/111
4	Left Front Fender	101.0	102	107	94
5	Left Front Door	101.2	101	103	100
6	Center Panel Left				
7	Left Rear Door	107.0	108	113	100
8	Left Back Panel	106.6	109	111	100
9	Right Front Fender	102.0	100	102	104
10	Right Front Door	109.0	108	111	108
11	Center Panel Right				
12	Right Rear Door	107.0	103	106	112
13	Right Back Panel	111.6	102	111	122

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Medium / (L) Front Floor Mat - Worked - Large / (R) Front Floor Mat - Grime - Medium / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Cut, Crack - Small / Ceiling - Grime - Small</p>	<p>Remarks (R) Rear Door, Molding - Scratch - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Roof - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Front Fender, Molding - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with warranty booklet, with jack, incomplete tools, with spare tire, with LTO plate, scratches on tail light</p>