

General Information

Date & Time: 03, Jun, 2025 16:00

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	24,987
Registration No.	NFF6113	Chassis No.	PA1B18F35R4240435
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



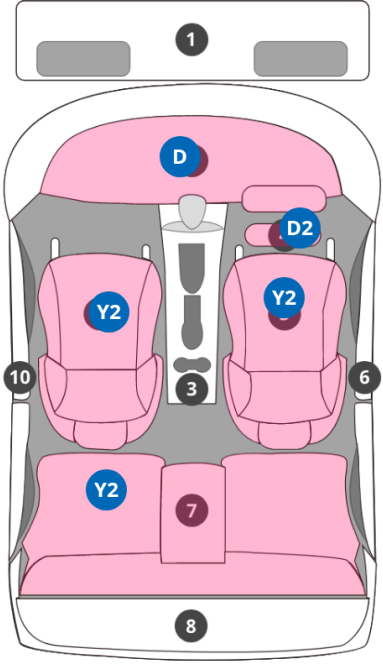
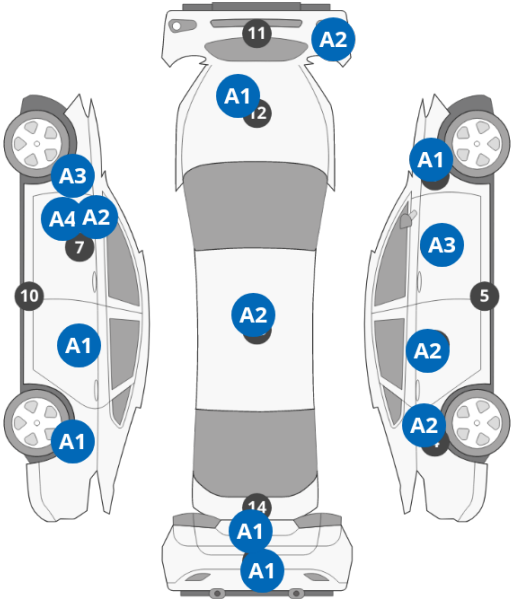
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	105.6	106	107	104
2	Boot Lid	106.0	108	102	108
3	Roof	99.8	102	97	99/102
4	Left Front Fender	111.6	91	146	98
5	Left Front Door	103.6	105	106	100
6	Center Panel Left				
7	Left Rear Door	100.3	107	100	94
8	Left Back Panel	109.0	108	109	110
9	Right Front Fender	97.8	98	96	99
10	Right Front Door	103.3	109	101	100
11	Center Panel Right				
12	Right Rear Door	101.9	100	99	107
13	Right Back Panel	112.3	112	110	115

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Worked - Small / (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Small / Rear Seat - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes</p>	<p>Remarks Rear Bumper, Lamps, Panels - Scratch - Minimal / (L) Front Door, Molding - Scratch - Large / (L) Front Fender, Molding - Scratch - Medium / (L) Mirror - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / Roof - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate and Jack, Spare tire and incomplete tools. no warranty booklet and scratch tail light and headlight.</p>