

General Information

Date & Time: 02, Jun, 2025 14:35

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	16,464
Registration No.	NHJ4608	Chassis No.	PA1B18F38P4211816
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



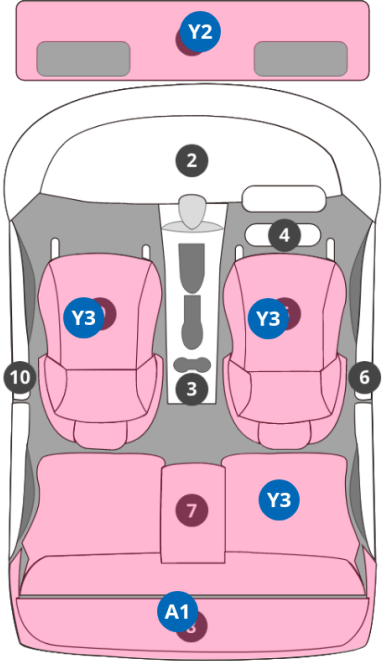
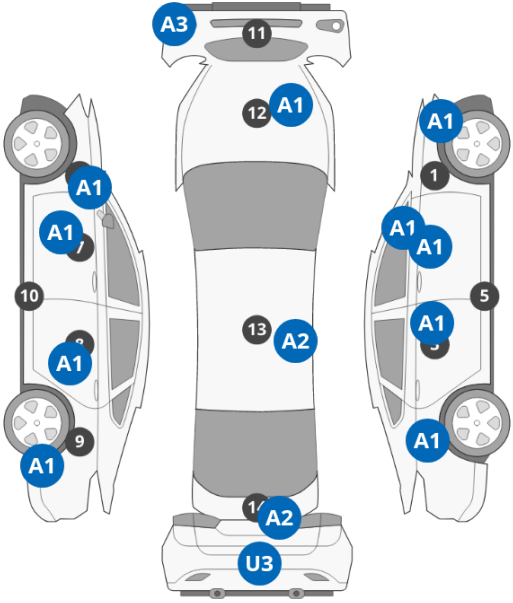
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	119.3	127	105	126
2	Boot Lid	120.6	108	135	119
3	Roof	98.7	98	102	95/100
4	Left Front Fender	102.3	106	101	100
5	Left Front Door	102.3	102	101	104
6	Center Panel Left				
7	Left Rear Door	107.6	107	103	113
8	Left Back Panel	114.6	127	112	105
9	Right Front Fender	105.0	108	101	106
10	Right Front Door	106.6	104	108	108
11	Center Panel Right				
12	Right Rear Door	110.0	101	113	116
13	Right Back Panel	106.6	100	100	120

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Small / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / Trunk Room - Worn, Scratch, Cut, Crack - Minimal / (L) Front Seat - Grime - Medium</p>	<p>Remarks Front Bumper, Grille, Lamps - Scratch - Medium / Rear Bumper, Lamps, Panels - Dent - Medium / (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / Roof - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes / Horn - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate, no warranty booklet, with jack and incomplete tools, with spare tire,</p>