

General Information

Date & Time: 19, Oct, 2024 09:57

Make	Toyota	Model	Rush
YOM	2023	Mileage	21,231
Registration No.	DBB6097	Chassis No.	MHKE8FF3PPK053129
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	SUV
Colour	White		

Body / Panel Condition



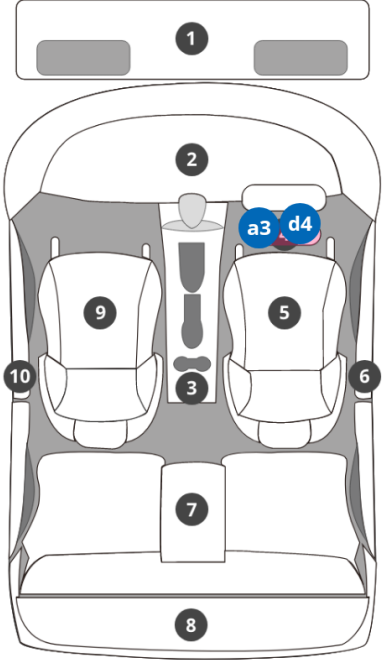
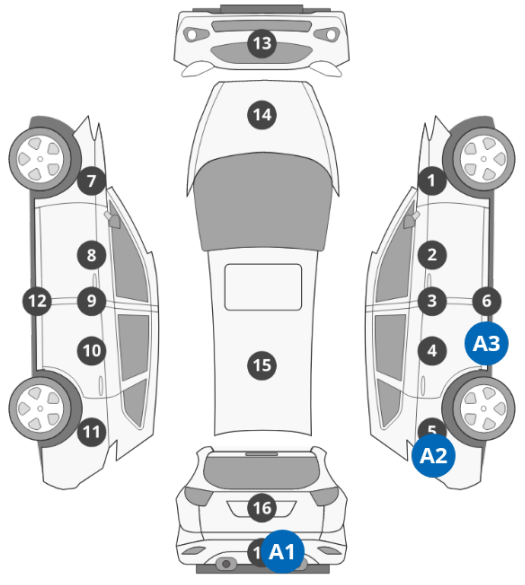
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	115.0	128	104	113
2	Boot Lid	113.3	110	112	118
3	Roof	107.8	95	109	115/113
4	Left Front Fender	112.0	116	110	110
5	Left Front Door	112.0	108	102	126
6	Center Panel Left				
7	Left Rear Door	101.7	101	94	110
8	Left Back Panel	107.0	108	105	108
9	Right Front Fender	108.0	116	105	103
10	Right Front Door	111.0	119	105	109
11	Center Panel Right				
12	Right Rear Door	124.0	112	128	132
13	Right Back Panel	109.0	107	107	113

Overall Evaluation :

A

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Lag - Cut, Crack - Medium	Remarks (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes

rock chips present/ hairline scratches and swirl marks present/ worn floor matts