

General Information

Date & Time: 04, Jun, 2025 16:59

| | | | |
|-------------------------|-------------------|--------------------------|-------------------|
| Make | Toyota | Model | Vios |
| YOM | 2021 | Odo Meter Reading | 38,209 |
| Registration No. | DAU7978 | Chassis No. | PA1B18F35M4139632 |
| CC | 1.3 | Transmission | CVT |
| Fuel Type | Gas | Type of Body | Sedan |
| Colour | Red Mica Metallic | | |

Body / Panel Condition



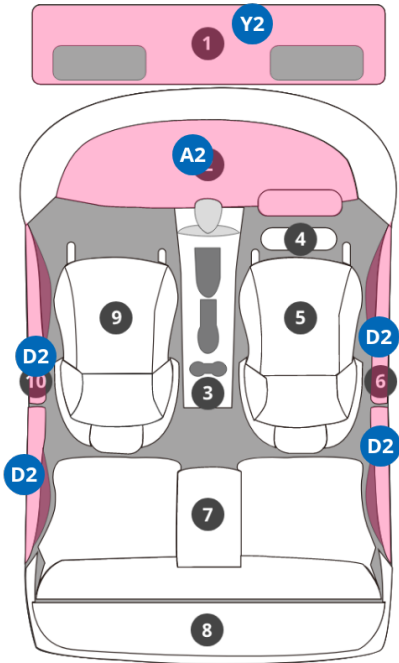
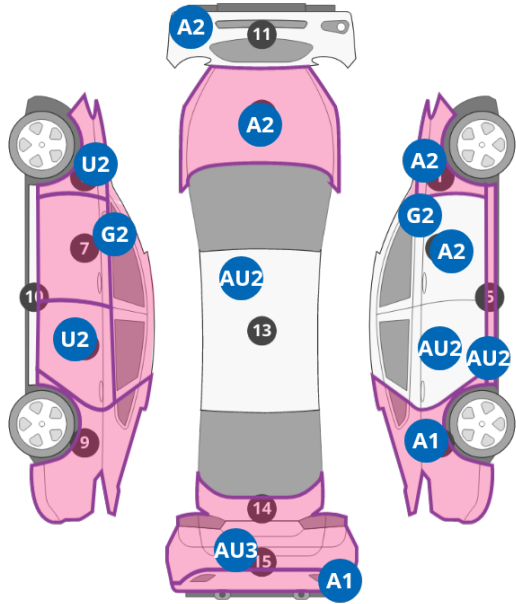
| # | Area | Thickness(um) | | | |
|----|--------------------|---------------|--------|--------|----------|
| | | Average | Value1 | Value2 | Value3/4 |
| 1 | Bonnet | 153.3 | 165 | 147 | 148 |
| 2 | Boot Lid | 251.6 | 229 | 283 | 243 |
| 3 | Roof | 154.0 | 142 | 170 | 153/151 |
| 4 | Left Front Fender | 427.3 | 554 | 383 | 345 |
| 5 | Left Front Door | 137.0 | 146 | 136 | 129 |
| 6 | Center Panel Left | | | | |
| 7 | Left Rear Door | 134.3 | 149 | 125 | 129 |
| 8 | Left Back Panel | 181.3 | 173 | 188 | 183 |
| 9 | Right Front Fender | 191.3 | 163 | 187 | 224 |
| 10 | Right Front Door | 148.0 | 156 | 133 | 155 |
| 11 | Center Panel Right | | | | |
| 12 | Right Rear Door | 165.0 | 197 | 147 | 151 |
| 13 | Right Back Panel | 180.0 | 163 | 193 | 184 |

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

| | |
|---|--|
| Interior Evaluation : C | Exterior Evaluation : E |
|  <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p> |  <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p> |
| <p>Remarks Overall Interior - Worn as per age - Yes / Ceiling - Grime - Small / Steering Wheel - Worn, Peel, Crack - Small / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small / (L) Rear Trim - Worked - Small / (R) Rear Trim - Worked - Small</p> | <p>Remarks (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / (R) Rear Fender, Molding - Repair mark - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / (L) Front Door, Molding - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch - Minimal / (L) Rear Door, Molding - Dent - Small / (L) Side Window - Scratch, Stone chip - Small / (L) Front Fender, Molding - Dent - Small / Front Bumper, Grille, Lamps - Scratch - Small / (R) Side Window - Scratch, Stone chip - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Minimal / Roof - Scratch & Dent - Small / Bonnet, Headlight - Scratch - Small</p> |
| Frame Evaluation : A | Functional Evaluation : A |
| <p>Remarks Defects not found</p> | <p>Remarks Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p> |

| |
|--|
| <p>Inspector Notes</p> |
| <p>With LTO plate and Jack, Sparetire. No warranty booklet and tools. scratch tail light and headlight. adhesive, marks.</p> |