

General Information

Date & Time: 04, Jun, 2025 14:44

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	32,026
Registration No.	NFS4186	Chassis No.	PA1B18F34P4234378
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



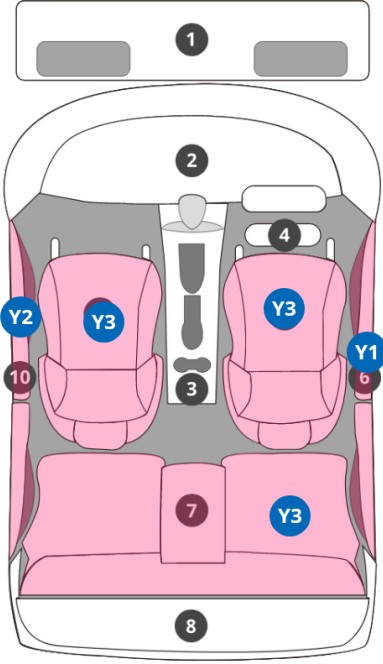
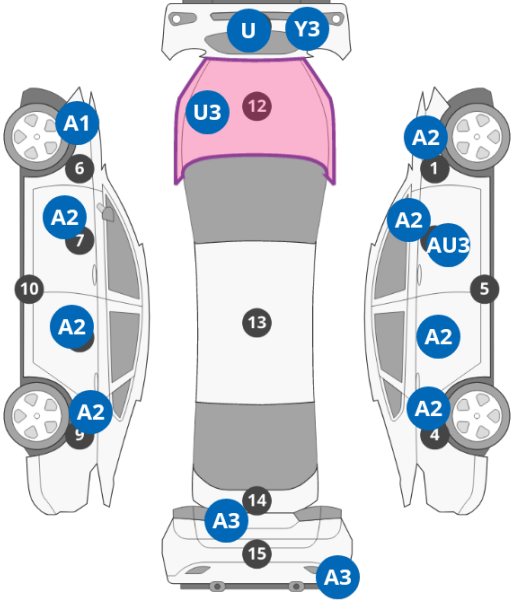
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	139.3	128	153	137
2	Boot Lid	105.6	106	107	104
3	Roof	101.3	99	106	96/105
4	Left Front Fender	100.4	102	100	99
5	Left Front Door	96.9	98	93	100
6	Center Panel Left				
7	Left Rear Door	104.5	118	100	96
8	Left Back Panel	104.1	109	105	98
9	Right Front Fender	97.4	96	94	102
10	Right Front Door	103.0	102	103	104
11	Center Panel Right				
12	Right Rear Door	105.6	105	102	110
13	Right Back Panel	102.4	95	98	114

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Medium / (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Medium / (R) Front Trim - Grime - Minimal / (L) Front Trim - Grime - Small</p>	<p>Remarks Bonnet, Headlight - Repair mark - Difference in Color / (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Crack, Gap - Medium / Bonnet, Headlight - Dent - Medium</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no warranty booklet, with jack, incomplete tools, with spare tire, with LTO plate, scratches on tail light</p>