

General Information

Date & Time: 04, Jun, 2025 09:48

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	33,107
Registration No.	NFR7655	Chassis No.	PA1B18F34R4256884
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



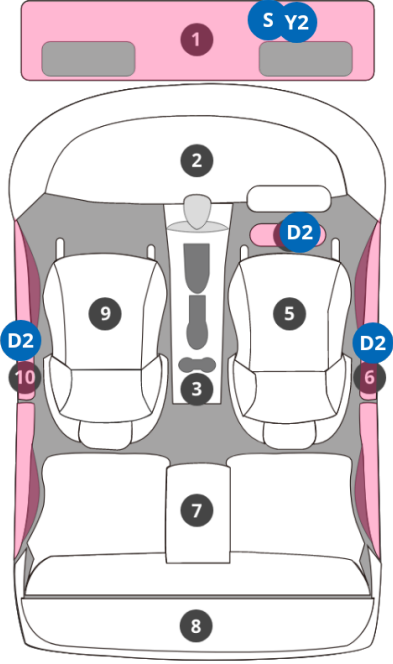
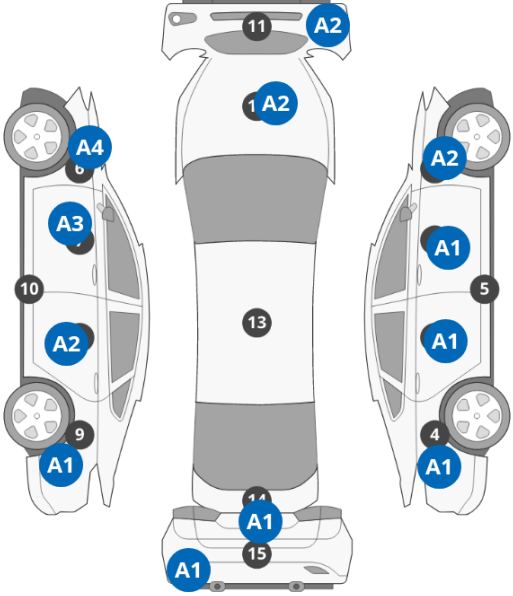
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	115.0	125	115	105
2	Boot Lid	105.0	102	106	107
3	Roof	101.6	107	102	102/95
4	Left Front Fender	99.4	102	96	100
5	Left Front Door	107.3	103	114	105
6	Center Panel Left				
7	Left Rear Door	99.9	102	101	97
8	Left Back Panel	114.0	120	114	108
9	Right Front Fender	99.7	107	97	95
10	Right Front Door	102.6	101	104	103
11	Center Panel Right				
12	Right Rear Door	105.3	102	106	108
13	Right Back Panel	128.6	173	103	110

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Overall Interior - Smell - Yes / Ceiling - Grime - Small / (L) Front Floor Mat - Worked - Small / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small</p>	<p>Remarks (R) Rear Fender - Repair Traces - Yes / (L) Front Door, Molding - Scratch - Medium / (L) Front Fender, Molding - Scratch - Large / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Defects not found</p>

<p>Inspector Notes</p>
<p>with warranty booklet and LTO plate, Jack and sparetire, Incomplete tools. scratch headlight and tail light.</p>