

General Information

Date & Time: 04, Jun, 2025 10:10

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	10,379
Registration No.	DBO6969	Chassis No.	PA1B18F3XR4256579
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition




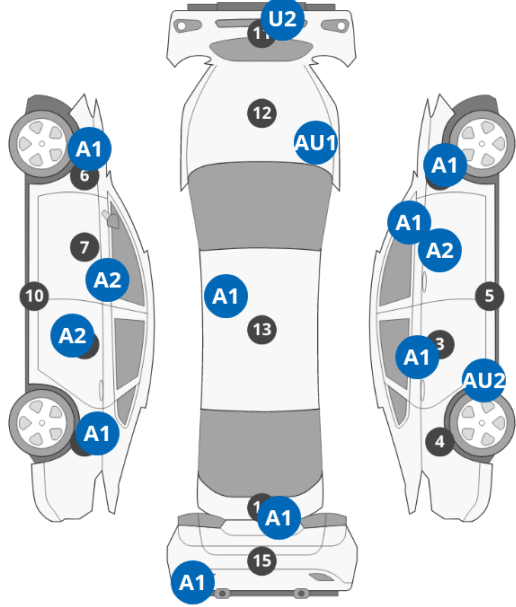
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	129.6	142	110	137
2	Boot Lid	120.6	116	118	128
3	Roof	113.2	116	112	112/113
4	Left Front Fender	107.6	111	102	110
5	Left Front Door	117.0	109	123	119
6	Center Panel Left				
7	Left Rear Door	118.3	123	120	112
8	Left Back Panel	119.6	135	113	111
9	Right Front Fender	116.0	121	113	114
10	Right Front Door	115.0	110	117	118
11	Center Panel Right				
12	Right Rear Door	119.3	120	119	119
13	Right Back Panel	116.3	113	118	118

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : B
<div style="text-align: center; background-color: #cccccc; padding: 50px;">  <p>No Image</p> </div> <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	<div style="text-align: center;">  </div> <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Trunk Room - Worn, Scratch, Cut, Crack - Minimal / Rear Seat - Grime - Medium / (R) Front Seat - Grime - Large / Mat Other - Missing - Yes / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes</p>	<p>Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / Roof - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Dent - Small / Bonnet, Headlight - Scratch & Dent - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Defects not found</p>

<p>Inspector Notes</p>
<p>no LTO plate, no warranty booklet, no jack and tools, no spare tire</p>