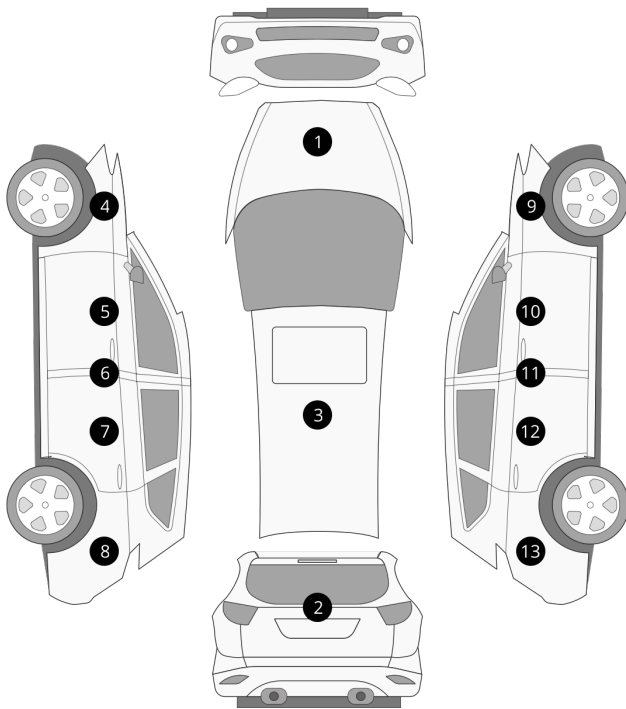


General Information

Date & Time: 29, May, 2025 17:55

Make	Toyota	Model	Fortuner
YOM	2018	Odo Meter Reading	89,943
Registration No.	NCC4116	Chassis No.	MHFJB8GS6H1541732
CC	2.4	Transmission	A/T
Fuel Type	Diesel	Type of Body	SUV
Colour	Silver		

Body / Panel Condition



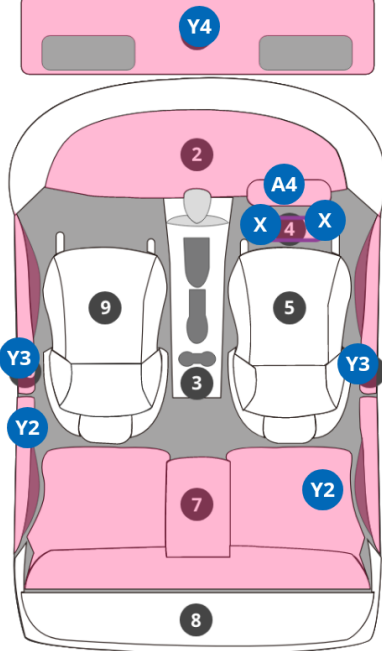
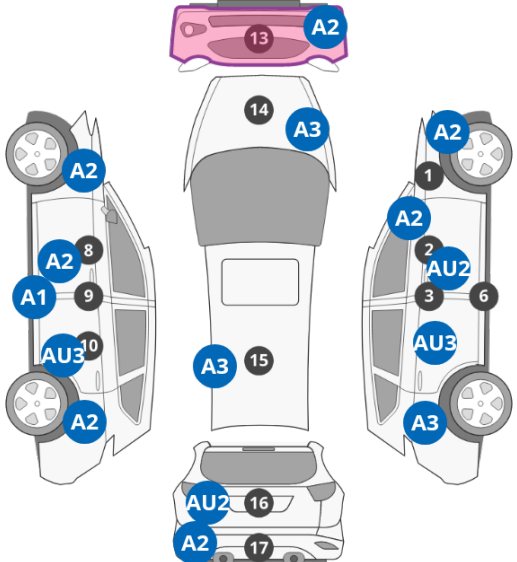
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	126.3	118	143	118
2	Boot Lid	124.0	114	141	117
3	Roof	114.2	115	128	111/103
4	Left Front Fender	181.3	187	180	177
5	Left Front Door	186.0	180	189	189
6	Center Panel Left				
7	Left Rear Door	135.3	185	112	109
8	Left Back Panel	117.6	125	113	115
9	Right Front Fender	122.3	126	122	119
10	Right Front Door	127.3	133	127	122
11	Center Panel Right				
12	Right Rear Door	118.3	114	113	128
13	Right Back Panel	125.0	128	116	131

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Large / (R) Front Trim - Grime - Medium / Rear Seat - Grime - Small / (L) Rear Trim - Grime - Small / (L) Front Floor Mat - Missing - Yes / (R) Front Floor Mat - Missing - Yes / Steering Wheel - Worn, Peel, Crack - Large / (L) Front Trim - Grime - Medium	Remarks (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Medium / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / Roof - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
Center armrest crinkle. lower glove box issue. Without warranty booklet, jack and tools. With spare tire. 1 key. with LTO plate.