

General Information

Date & Time: 30, May, 2025 08:52

Make	Toyota	Model	Hiace
YOM	2023	Odo Meter Reading	35,240
Registration No.	NEE9730	Chassis No.	JTFJT02P2P0016546
CC	3.0	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	Silver		

Body / Panel Condition



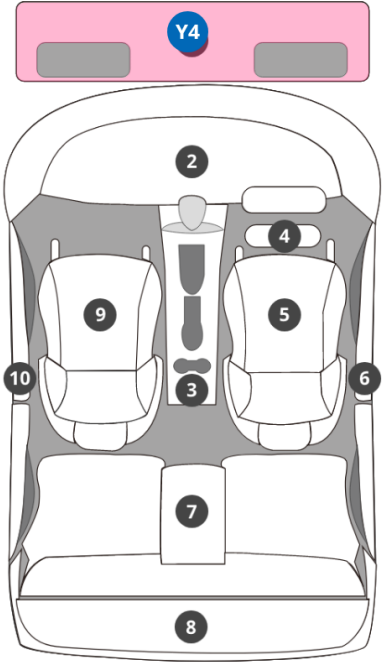
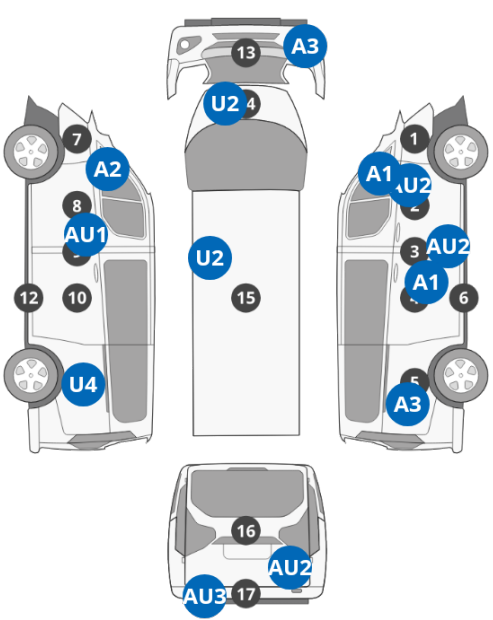
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	97.3	98	97	97
2	Boot Lid	102.2	95	114	98
3	Roof	82.2	81	78	89/81
4	Left Front Fender	96.7	100	98	93
5	Left Front Door	93.0	93	92	95
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	97.9	100	100	94
9	Right Front Fender	96.8	102	95	94
10	Right Front Door	88.2	89	89	87
11	Center Panel Right				
12	Right Rear Door	97.5	98	95	100
13	Right Back Panel	99.8	101	98	101

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Large	Remarks (L) Rear Fender, Molding - Dent - Large / (L) Mirror - Scratch - Small / Bonnet, Headlight - Dent - Small / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Front Door, Molding - Scratch & Dent - Small / (R) Mirror - Scratch - Minimal / (R) Center Panel - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Roof - Dent - Small / (L) Front Door, Molding - Scratch & Dent - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
Crack right taillight. With warranty booklet, jack and spare tire. Without tools. 1 key. With Lto plate.