

General Information

Date & Time: 30, May, 2025 13:02

Make	Nissan	Model	NV350
YOM	2020	Odo Meter Reading	40,148
Registration No.	CAT9196	Chassis No.	JN1TC2E26Z0060587
CC	2.5	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	Silver		

Body / Panel Condition



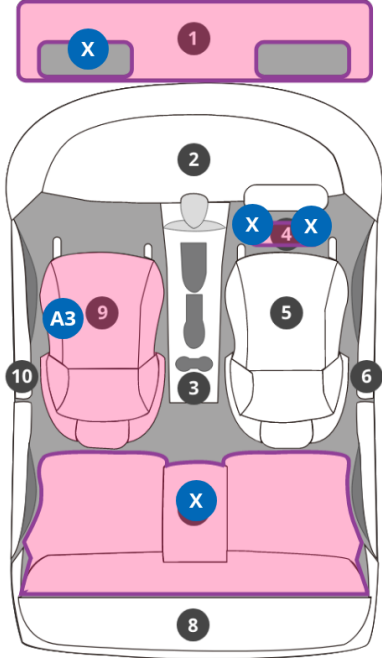
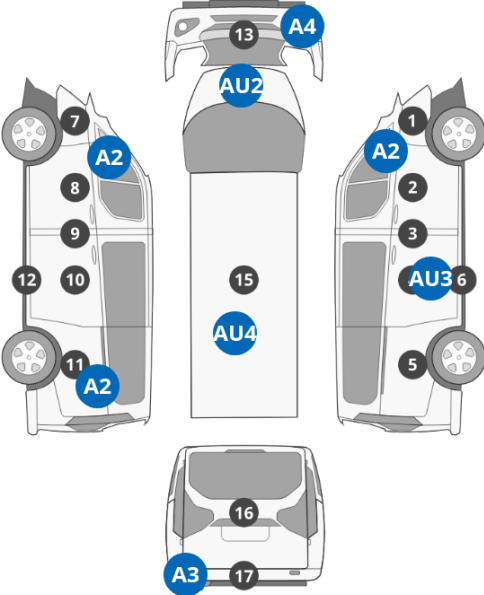
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	92.4	92	87	99
2	Boot Lid	146.0	139	147	152
3	Roof	96.1	97	89	109/90
4	Left Front Fender	95.7	97	94	96
5	Left Front Door	102.3	107	100	100
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	145.3	155	143	138
9	Right Front Fender	96.0	95	95	98
10	Right Front Door	138.6	112	170	134
11	Center Panel Right				
12	Right Rear Door	144.6	142	139	153
13	Right Back Panel	105.3	100	105	111

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C		Exterior Evaluation : C	
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain		 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap	
Remarks Rear Seat - Partially Missing - Yes / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / (L) Front Seat - Cut, Crack - Medium / Sunvisor, Sunglass Holder - Missing - Yes		Remarks Bonnet, Headlight - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Large / (R) Rear Door, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (R) Mirror - Scratch - Small / Roof - Scratch & Dent - Large	
Frame Evaluation : A		Functional Evaluation : A	
Remarks Defects not found		Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist	

Inspector Notes

Last row seat missing. Both sunvisors missing. without warranty booklet, jack and tools. With spare tire. 1 key. With LTO plate