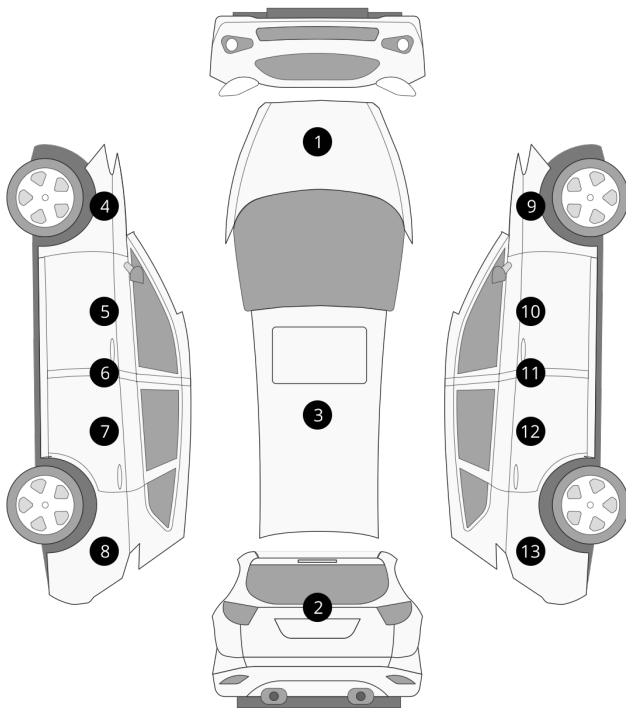


General Information

Date & Time: 21, Oct, 2024 09:57

Make	Toyota	Model	Innova
YOM	2023	Mileage	21,745
Registration No.	NIK3133	Chassis No.	PA2AA8EM0P0123576
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Red		

Body / Panel Condition



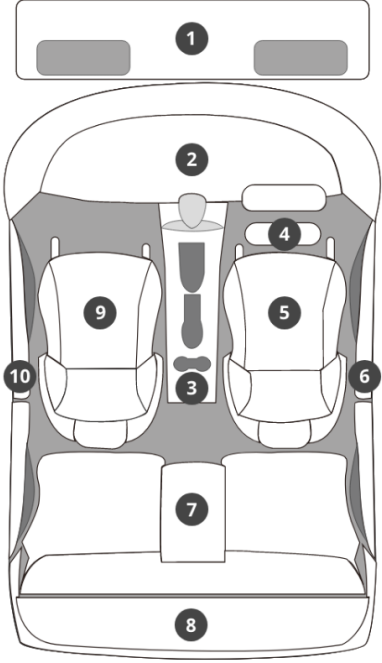
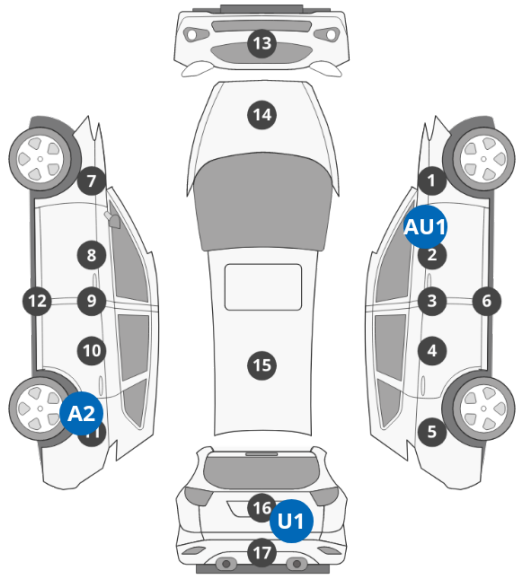
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	126.3	128	131	120
2	Boot Lid	117.5	106	99	148
3	Roof	119.0	106	122	106/142
4	Left Front Fender	101.1	96	103	104
5	Left Front Door	107.0	107	109	105
6	Center Panel Left				
7	Left Rear Door	118.3	108	121	126
8	Left Back Panel	131.0	152	115	126
9	Right Front Fender	109.0	110	112	105
10	Right Front Door	112.6	114	115	109
11	Center Panel Right				
12	Right Rear Door	113.0	109	115	115
13	Right Back Panel	112.6	105	114	119

Overall Evaluation :

A

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : A	Exterior Evaluation : A
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Defects not found	Remarks (R) Front Door, Molding - Scratch & Dent - Minimal / (L) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Dent - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Lamps (Brake, Tail, Fog) - Issue - Yes

Inspector Notes
aftermarket headlight/twilight cover/ hairline scratches/ dirt marks on seats/