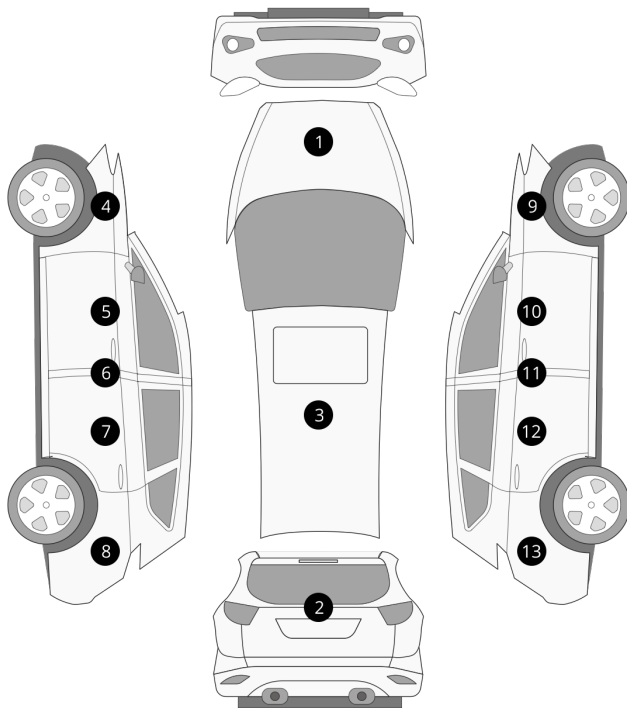


General Information

Date & Time: 30, May, 2025 10:55

Make	Mitsubishi	Model	Lancer Ex
YOM	2013	Odo Meter Reading	70,140
Registration No.	UMQ932	Chassis No.	PAECY1ASCCA000267
CC	1.8	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



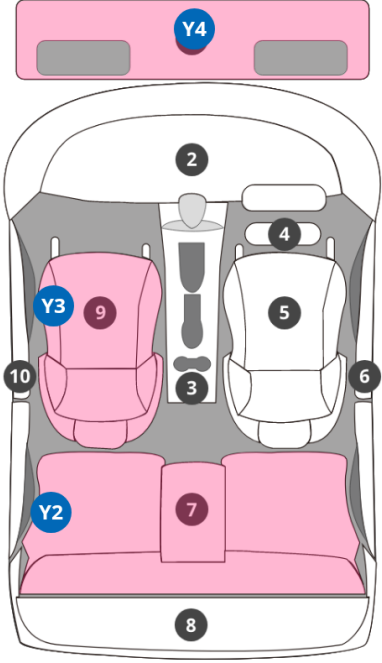
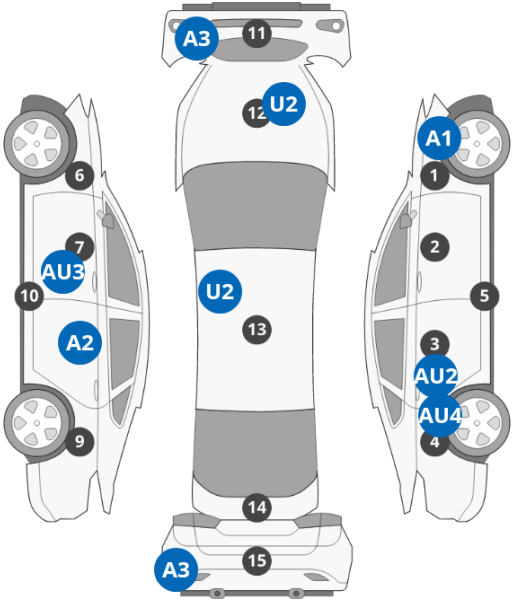
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	180.0	182	168	190
2	Boot Lid	104.5	96	103	115
3	Roof	155.5	168	140	159/155
4	Left Front Fender	195.3	184	198	204
5	Left Front Door	139.3	163	147	108
6	Center Panel Left				
7	Left Rear Door	108.6	110	107	109
8	Left Back Panel	106.4	112	109	98
9	Right Front Fender	155.0	149	156	160
10	Right Front Door	163.6	168	143	180
11	Center Panel Right				
12	Right Rear Door	206.6	203	209	208
13	Right Back Panel	198.3	174	179	242

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Large / Rear Seat - Grime - Small / (L) Front Seat - Grime - Medium	Remarks Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Dent - Small / (L) Front Door, Molding - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Small / Bonnet, Headlight - Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Retractable Mirror - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
Without warranty booklet, seat cover and tools. with spare tire and jack. 1 key. with LTO plate