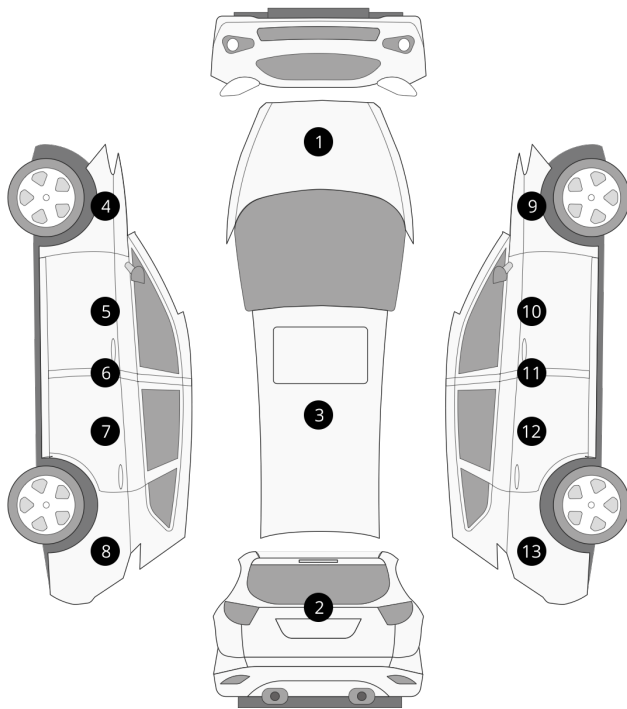


General Information

Date & Time: 31, May, 2025 13:19

Make	Toyota	Model	Innova
YOM	2022	Odo Meter Reading	84,470
Registration No.	EAF4812	Chassis No.	PA2JA8EMXN0114137
CC	2.8	Transmission	M/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Black		

Body / Panel Condition



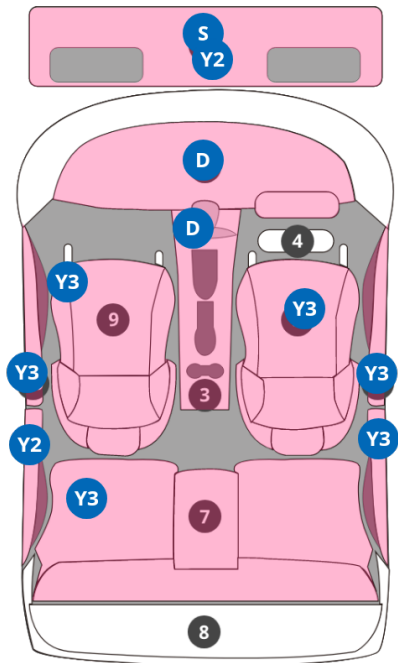
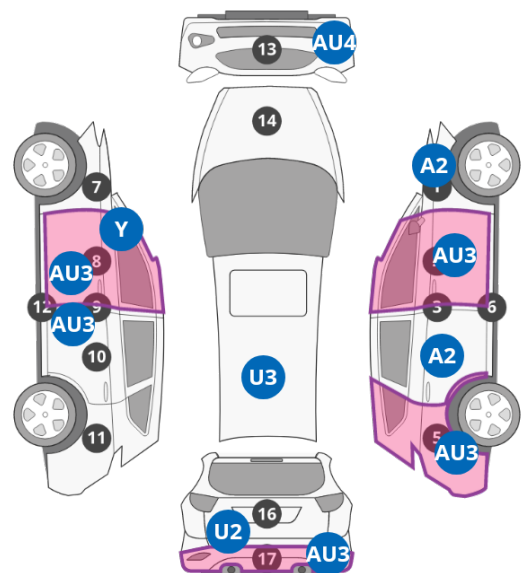
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.0	109	115	109
2	Boot Lid	164.0	169	159	164
3	Roof	95.4	102	99	87/94
4	Left Front Fender	98.6	99	99	99
5	Left Front Door	110.6	111	107	114
6	Center Panel Left				
7	Left Rear Door	126.6	139	113	128
8	Left Back Panel	125.6	157	110	110
9	Right Front Fender	101.3	100	104	100
10	Right Front Door	105.6	101	110	106
11	Center Panel Right				
12	Right Rear Door	103.8	103	98	110
13	Right Back Panel	112.6	112	109	117

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Smell - Yes / (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Medium / (R) Rear Trim - Grime - Medium / Ceiling - Grime - Small / Rear Seat - Grime - Medium / (L) Rear Trim - Grime - Small / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Medium / Console, Switchs, Vents - Traces of Adhesive Tape - Yes / Dashboard - Traces of Adhesive Tape - Yes	Remarks (L) Front Door, Molding - Repair mark - Yes / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Front Door, Molding - Repair mark - Yes / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch & Dent - Medium / (R) Rear Fender, Molding - Repair mark - Yes / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Dent - Small / (R) Front Fender, Molding - Scratch - Small / (L) Mirror - Crack - Damaged / Roof - Dent - Medium / (R) Rear Door, Molding - Scratch - Small
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Air Conditioner - Function - Weak / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes

Possible flooding. Muddy carpets. fog light partially missing. Without warranty booklet and seat cover. With spare tire, jack and tools. 1 key. with LTO plate