

General Information

Date & Time: 31, May, 2025 10:55

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	55,369
Registration No.	CCA6516	Chassis No.	PA1B18F38R4249257
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



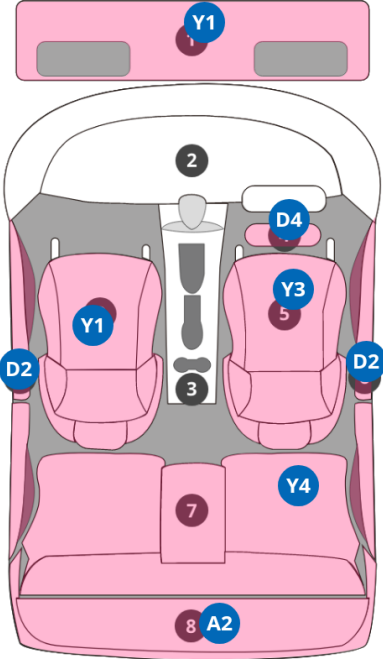
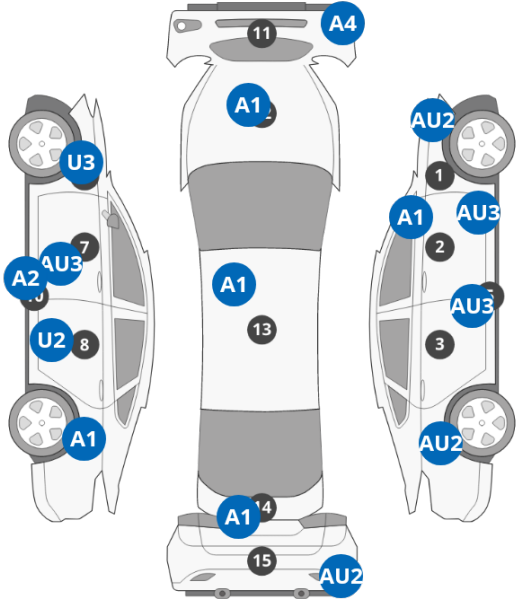
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.6	117	105	113
2	Boot Lid	101.3	105	100	99
3	Roof	98.0	100	101	90/102
4	Left Front Fender	97.2	98	93	100
5	Left Front Door	100.1	98	106	97
6	Center Panel Left				
7	Left Rear Door	100.8	104	101	98
8	Left Back Panel	105.8	116	103	99
9	Right Front Fender	106.3	108	104	107
10	Right Front Door	113.0	124	103	112
11	Center Panel Right				
12	Right Rear Door	108.1	97	102	125
13	Right Back Panel	104.6	106	105	103

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Medium / Rear Seat - Grime - Large / Trunk Room - Worn, Scratch, Cut, Crack - Small / (L) Front Trim - Worked - Small / (L) Front Floor Mat - Worked - Large / (L) Front Seat - Grime - Minimal / Ceiling - Grime - Minimal / (R) Front Trim - Worked - Small</p>	<p>Remarks (R) Front Fender, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Mirror - Scratch - Minimal / (R) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch - Minimal / Roof - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Dent - Small / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Front Fender, Molding - Dent - Medium / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : C
<p>Remarks Defects not found</p>	<p>Remarks Power Steering - Issue - Yes / Battery - Weak - Yes</p>

<p>Inspector Notes</p>
<p>with LTO plate, no warranty booklet, no jack, incomplete tools, with spare tire</p>