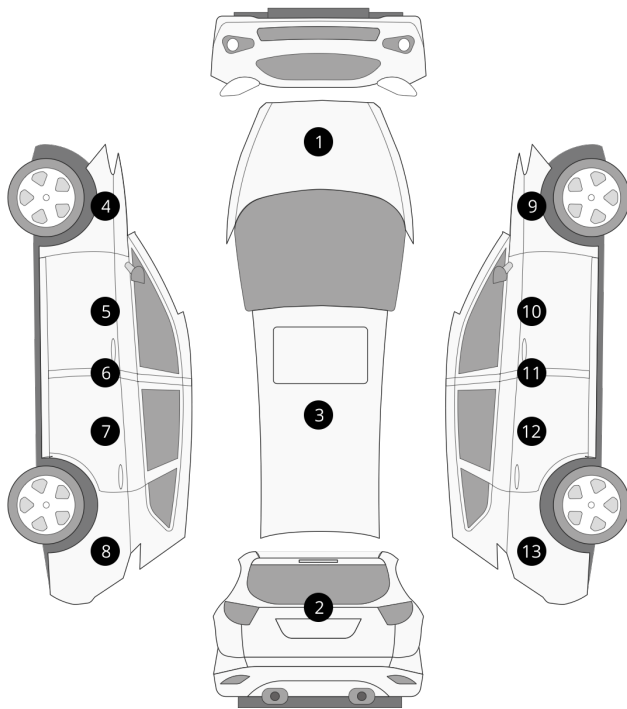


General Information

Date & Time: 31, May, 2025 10:38

Make	Ford	Model	Everest
YOM	2015	Odo Meter Reading	119,766
Registration No.	ABO3858	Chassis No.	MNCUS4D10EW509053
CC	2.5	Transmission	A/T
Fuel Type	Diesel	Type of Body	SUV
Colour	White		

Body / Panel Condition



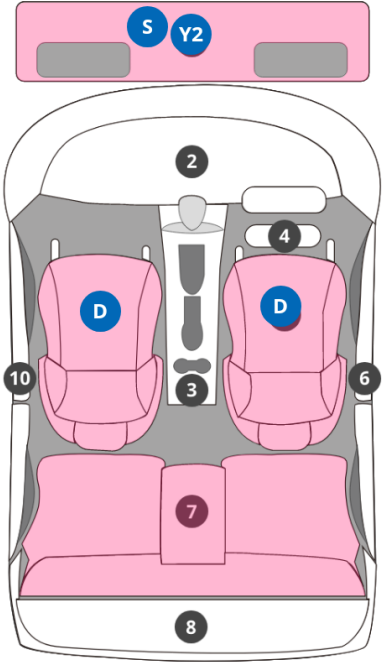
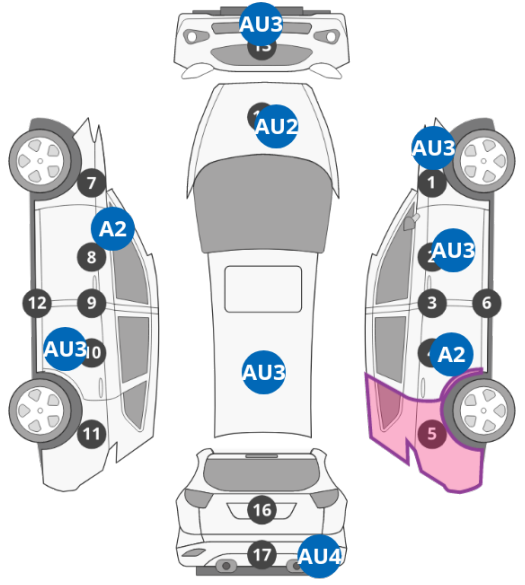
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	83.3	86	84	81
2	Boot Lid	74.6	74	76	75
3	Roof	86.3	126	61	78/81
4	Left Front Fender	87.1	95	85	82
5	Left Front Door	92.5	96	95	87
6	Center Panel Left				
7	Left Rear Door	92.7	103	87	88
8	Left Back Panel	127.0	111	108	162
9	Right Front Fender	87.3	84	84	93
10	Right Front Door	96.8	88	99	103
11	Center Panel Right				
12	Right Rear Door	92.9	95	100	84
13	Right Back Panel	91.9	89	95	92

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Worn as per age - Yes / (R) Front Seat - Worn - Yes / Ceiling - Grime - Small / Rear Seat - Worn - Yes / (L) Front Seat - Worn - Yes / Overall Interior - Smell - Yes	Remarks (L) Rear Fender - Repair Traces - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / (R) Front Fender, Molding - Scratch & Dent - Medium / Bonnet, Headlight - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (R) Rear Fender, Molding - Repair mark - Yes / (R) Rear Door, Molding - Scratch - Small / Roof - Scratch & Dent - Medium
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Retractable Mirror - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes

Left reverse light issue. Without warranty booklet, seat cover and tools. With spare tire and jack. 1 key. With LTO plate